

DISTRICT I

P.O. Box 1980, Hobbs, NM 88240

DISTRICT II

P.O. Box Drawer DD, Artesia, NM 88210

DISTRICT III

1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088

Santa Fe, New Mexico 87504-2088

WELL API NO.	30-025-26001
5. Indicate Type of Lease	STATE ☒ FEE ☐
6. State Oil / Gas Lease No.	B-155-1
7. Lease Name or Unit Agreement Name	CENTRAL VACUUM UNIT
8. Well No.	141
9. Pool Name or Wildcat	VACUUM GRAYBURG SAN ANDRES

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT (FORM C-101) FOR SUCH PROPOSALS.	
1. Type of Well:	OIL ☐ GAS ☐ WELL ☐ WELL ☐ OTHER ☐ WATER INJECTION
2. Name of Operator	TEXACO EXPLORATION & PRODUCTION INC.
3. Address of Operator	205 E. Bender, HOBBS, NM 88240
4. Well Location	Unit Letter <u>M</u> <u>10</u> Feet From The <u>SOUTH</u> Line and <u>1310</u> Feet From The <u>WEST</u> Line Section <u>36</u> Township <u>17S</u> Range <u>34E</u> NMPM <u>LEA</u> COUNTY
10. Elevation (Show whether DF, RKB, RT, GR, etc.)	3991' GR

11.

Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☒ ALTERING CASING ☐
COMMENCE DRILLING OPERATION ☐ PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☐
OTHER: ☐ FRAC UPPER SAN ANDRES ☒

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1-25-01: MIRU. SET BLOW DN TANK.
1-26-01: REL PKR. NUBOP.
1-30-01: TIH W/BIT & 2 3/8" TBG TO 4333'. DRILL W/PARTIAL RETURNS TO 4633'. PULL BIT TO 4260'.
1-31-01: TAG FILL @ 4580'. WASH DN TO 4633'. DRILL ON METAL 2 HRS. TIH W/CONE BUSTER MILL TO 4242'.
2-01-01: TAG @ 4633'. DRILL 1 HR. FELL THRU. C/O TO PBTD @ 4776'. TIH OPEN ENDED TO 4320'. SPOT 3000# 20/40 SAND. TIH & TAG SAND @ 4575'.
2-02-01: TAG SAND @ 4575'. PUMP 1100# 20/40 SAND DN TBG. TAG SAND @ 4480'. PERF 4360-76, 4381-90.
2-03-01: PU FRAC PKR & 2 7/8" TBG. TEST IN HLE TO 8500 PSI. SET PKR @ 4208'. TEST CSG TO 700 PSI.
2-13-01: ACIDIZE & FRAC SAN ANDRES PERFS FR 4360-4453 W/2000 GALS NEFE HCL & 33,000 GALS YF-135 W/58,000# 20/40 BRADY SAND.
2-19-01: TIH W/WASH TIP ON COIL TBG. C/O FRAC SAND TO 4300'.
2-20-01: MIRU REV UNIT. REL PKR & PMP 50 BBLS TO REV OUT SAND. LEFT PKR SWINGING @ 1670'.
2-21-01: TIH W/CONE BUSTER MILL, DC'S. TAG SAND @ 4298'. BREAK CIRC. C/O TO 4430'. LOST CIRC. C/O TO 4498'. PULL MILL TO 4275'.
2-22-01: TAG BAD CSG @ 4440'. DRILL ON BAD CSG 4440-4520. GOOD DRLG FR 4520-4675'. DRILL ON BAD CSG 4675-4699. PULL MILL TO 4275'.
2-23-01: TIH W/NEW MILL & TAG @ 4698'. BREAK CIRC W/130 BBLS. DRILL BAD CSG TO 4705'. C/O SAND TO TD @ 4776'. STOP MILL @ 3990'.
2-26-01: TEST PKR, ON/OFF TOOL W/PROFILE, 2 3/8" TBG TO 4273'.
2-27-01: ATTEMPT TO SET PKR @ 4304'. MOVE PKR TO 4272'. ATTEMPT TO TEST. NO SUCCESS.
3-01-01: TEST TBG IN HLE TO 3000 PSI. PKR SET @ 4272'. REL ON/OFF TOOL. CIRC TRTD WTR. RELATCH ON/OFF TOOL. NDBOP. NU NEW TREE. CIW TEST TREE TO 3000 PSI. TEST & CHART CSG & PKR TO 570 PSI FOR 30 MINS-OK. (CHART ATTACHED) SHEAR PUMP OUT PLUG @ 1500 PSI.
RIG DOWN.
3-23-01: ON 24 HR OPT. INJ'G 2362 BWPD @ 1499 PSI.

FINAL REPORT

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE J. Denise Leake TITLE Engineering Assistant

DATE 3/26/01

TYPE OR PRINT NAME J. Denise Leake

Telephone No. 397-0405

(This space for State Use)


APPROVED

CONDITIONS OF APPROVAL IF ANY: _____ TITLE _____

GARY VANK

DATE _____

JCS

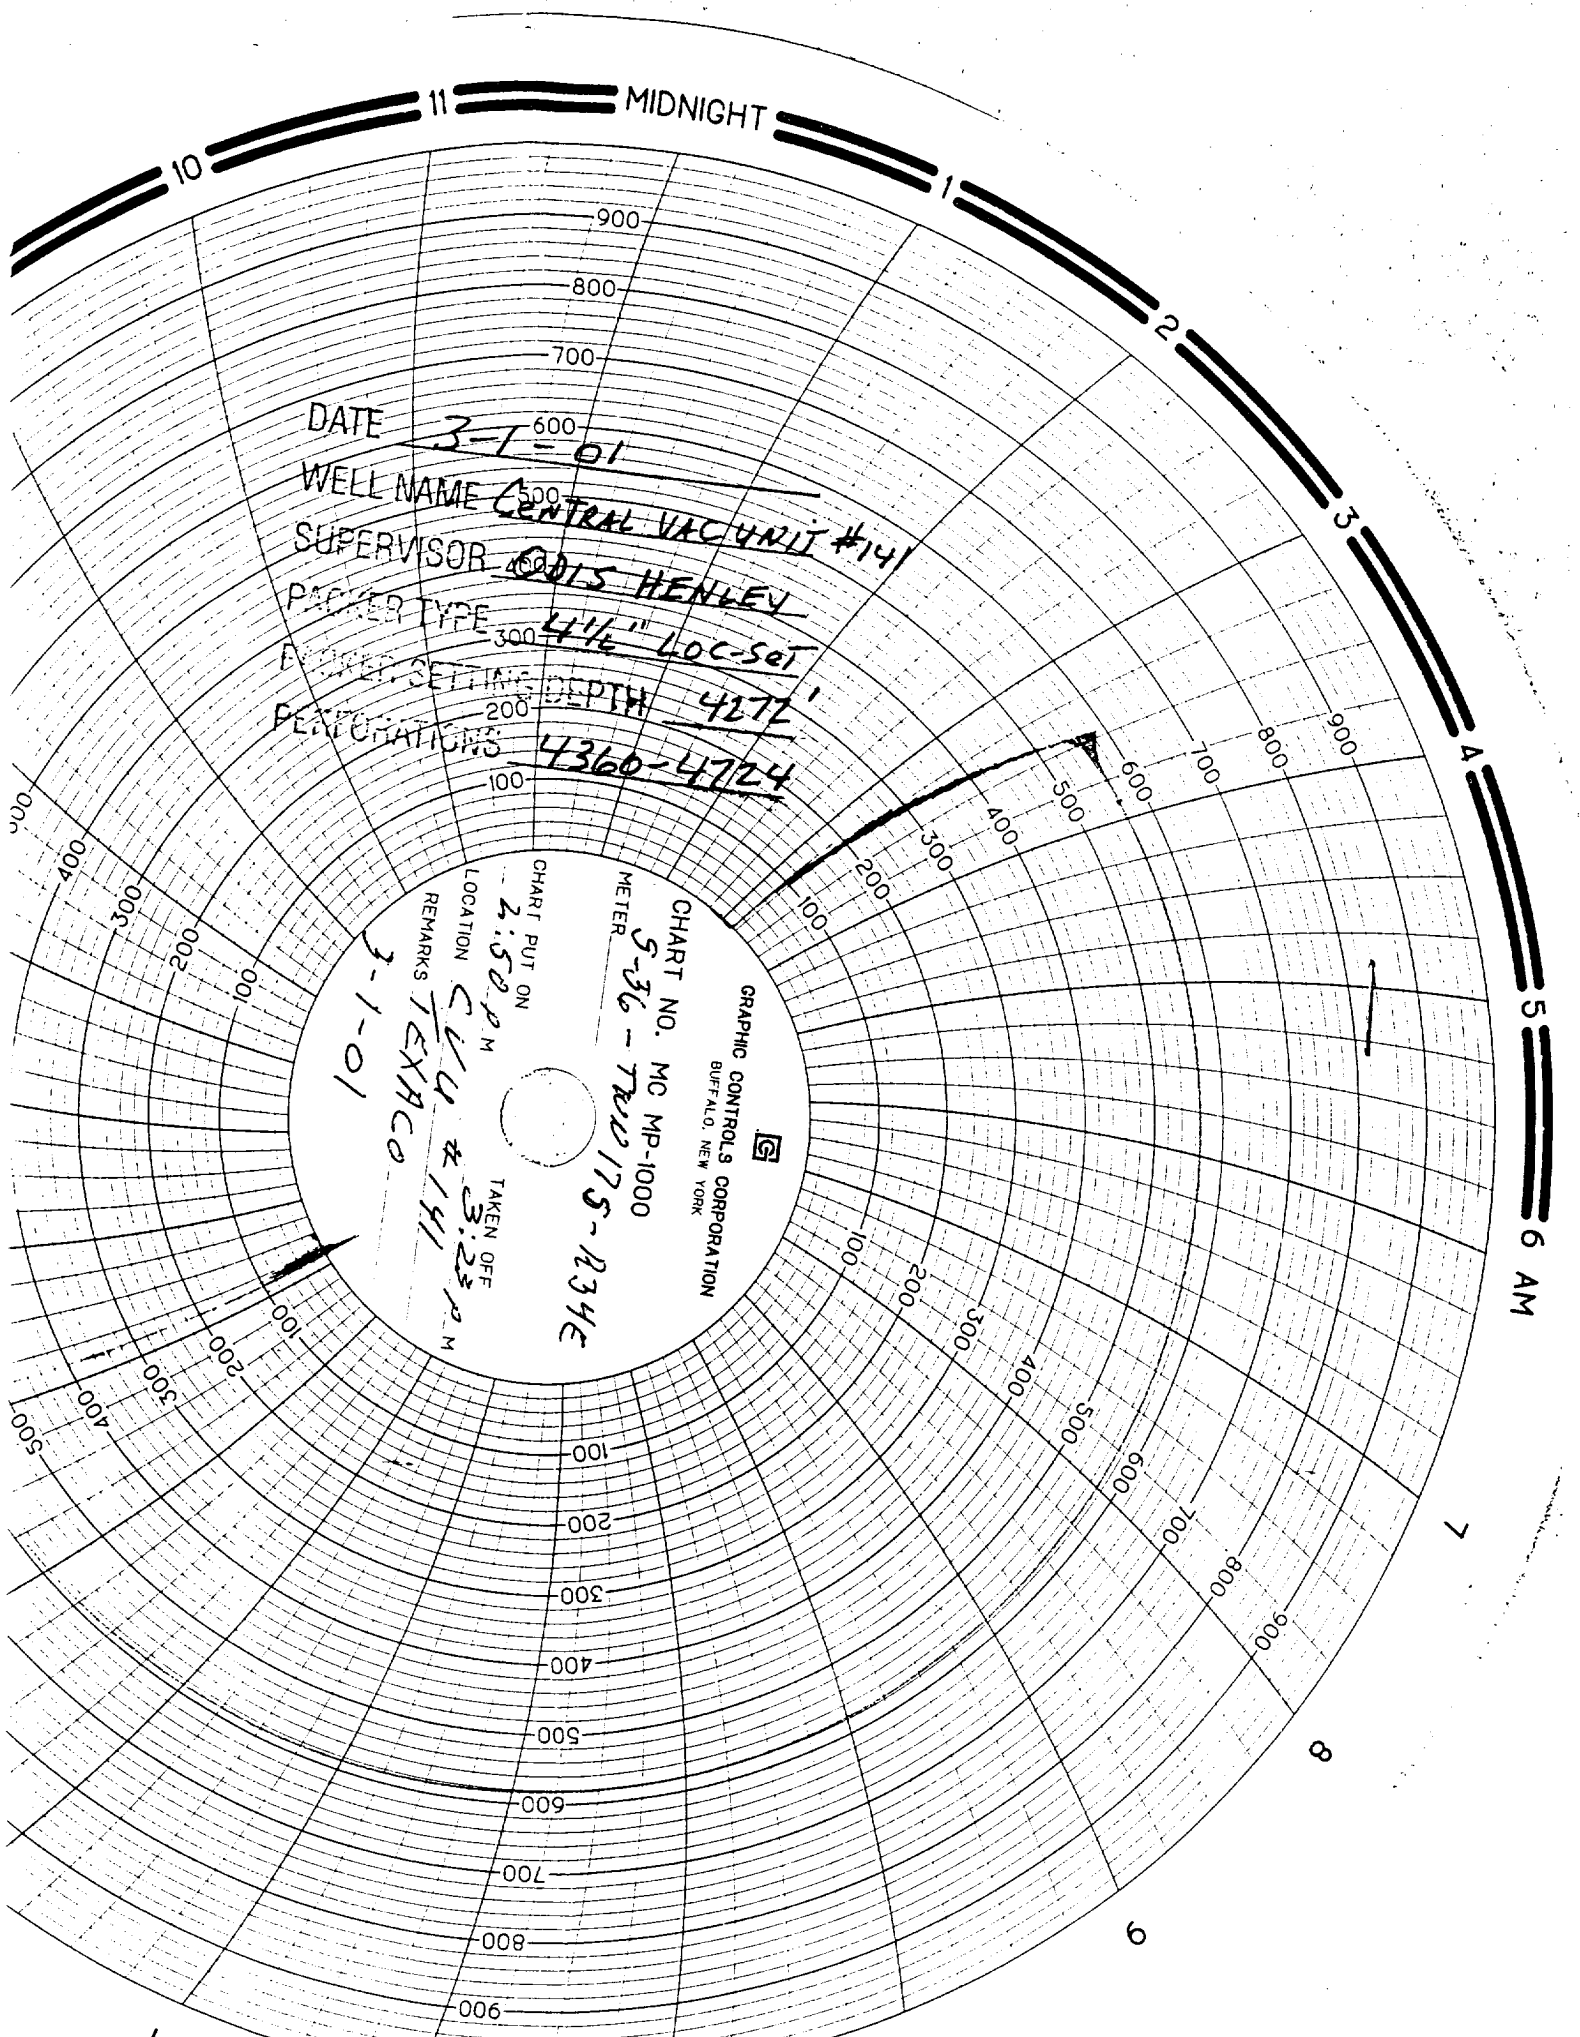

DATE 3-1-01
WELL NAME CENTRAL VAC UNIT #141
SUPERVISOR BOB HENLEY
PACKER TYPE 4 1/4" LOC-SET
PERFORATIONS 4272'
4360-4724

CHART NO. MC MP-1000
METER 5-36-TW0175-R34E
LOCATION C/VU #141
REMARKS EXHCO
CHART PUT ON 2:50 P.M.
TAKEN OFF 3:25 P.M.
3-1-01

GRAPHIC CONTROLS CORPORATION
BUFFALO, NEW YORK