

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO. 30-CRS-20494
5. Indicate Type of Lease STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name COX
8. Well No. 1
9. Pool name or Wildcat KNOWLES S., DEVONIAN

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER
2. Name of Operator V-F PETROLEUM INC.
3. Address of Operator ONE MARIENFELD PLACE, STE 580 MIDLAND, TX 79701
4. Well Location Unit Letter F : 1980 Feet From The NORTH Line and 1980 Feet From The WEST Line Section 13 Township 17-S Range 38-E NMPM LEA County
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3700' KB

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☐
OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. PULL ALL PRODUCTION EQUIPMENT.
2. SET CIBP @ 12,000'. DUMP 50' CEMENT ON TOP OF PLUG.
3. SHOOT OFF 5 1/2" CASING @ 5000'. PULL & LAY DOWN CASING.
4. TIH WITH 2 3/8" TUBING TO 5050'.
5. CIRCULATE HOLE WITH 9# PER GAL. MUD.
6. SPOT 50 SX CEMENT PLUG @ 4900' - 5050'.
7. SPOT 50 SX CEMENT PLUG @ 300' - 400'.
8. SPOT 10 SX CEMENT PLUG @ 0 - 10'.
9. CUT OFF WELLHEAD & INSTALL DRY HOLE MARKER.
10. MOVE ALL EQUIPMENT OFF LOCATION & CLEAN & LEVEL LOCATION.

will need 20 SX PLUG @ 8500

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Kenneth E. Stull TITLE ENGINEERING TECHNICIAN DATE 8/29/91
TYPE OR PRINT NAME KENNETH E. STULL TELEPHONE NO. (915) 683-3344

(This space for State Use)

ORIGINAL SIGNED BY JERRY SEXTON
APPROVED BY DISTRICT I SUPERVISOR TITLE _____ DATE _____

CONDITIONS OF APPROVAL, IF ANY:

THE COMMISSION MUST BE NOTIFIED 24
HOURS PRIOR TO THE BEGINNING OF
SUSPENSIVE OPERATIONS FOR THE C-103