

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

1
R -89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO.	30-025-26794
5. Indicate Type of Lease	STATE ☒ FEE ☐
6. State Oil & Gas Lease No.	011122
7. Lease Name or Unit Agreement Name	
Central Vacuum Unit	
8. Well No.	150
9. Pool name or Wildcat	Vacuum Grayburg San Andres

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:	OR. WELL ☐ GAS WELL ☐ OTHER injection
2. Name of Operator	Texaco E&P Inc.
3. Address of Operator	P.O. Box 3109 Midland, TX 79702
4. Well Location	Unit Letter B : 10 Feet From The North Line and 1330 Feet From The East Line
Section 30	Township 17S Range 35E NMPM Lea County

10. Elevation (Show whether DF, RKB, RT, GR, etc.)	3972' GR
--	----------

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK ☐	REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐	ALTERING CASING ☐
PULL OR ALTER CASING ☐	COMMENCE DRILLING OPNS. ☐
OTHER: ☐	PLUG AND ABANDONMENT ☐
	CASING TEST AND CEMENT JOB ☐
	OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. Notify NMOCD of intent to plug & abandon prior to moving unit on well.
2. TIH w/tub & PKR to @ 4500. SQ (San Andres perf. 4592-4703) w/150 sxs.class C cmt displace below PKR WOC & tag.
3. POOH to 3900'-Spot 15sxs cmt. f/3900-3800 (Queens) WOC & tag.
4. POOH to 3000'-Spot 45 sxs cmt. plug. f/3000-2700 (Yates-B salt) WOC & tag.
5. POOH to 1800'-Spot 15 sxs cmt. plug. f/1800-1700 (top salt) WOC & tag.
6. POOH to 1630'- Spot 15 sxs cmt. plug. f/1630-1530 (8-5/8" shoe)
7. POOH to 400' Spot 15 sxs cmt. plug f/400-300 (13-3/8" shoe)
8. POOH to 50' Spot 10 sxs cmt. plug f/50-surface
9. Cut off wellhead & weld on cap & install dry hole marker.

25 SXS MINIMUM

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE RJ Harding III TITLE Operations Engineer DATE 10-5-94

TYPE OR PRINT NAME RJ Harding III TELEPHONE NO. 915-688-481

(This space for State Use)

APPROVED BY _____ TITLE _____ DATE OCT 12 1994

CONDITIONS OF APPROVAL, IF ANY: