

STATE OF NEW MEXICO
ENERGY AND MINERALS DEPARTMENT

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

OIL CONSERVATION DIVISION
P. O. BOX 2088
SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-78

5a. Indicate Type of Lease	
State ☒	Fed ☐
5. State Oil & Gas Lease No.	
3-1056-1	

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE "APPLICATION FOR PERMITS" (FORM C-101) FOR SUCH PROPOSALS.)

1. ☒ OIL WELL ☐ GAS WELL ☐ OTHER-		7. Unit Agreement Name
2. Name of Operator TEXACO Inc.		8. Farm or Lease Name New Mexico '3' State
3. Address of Operator P. O. Box 728, Hobbs, New Mexico 88240		9. Well No. 9
4. Location of Well UNIT LETTER J, 2310 FEET FROM THE South LINE AND 2308 FEET FROM THE East LINE, SECTION 25 TOWNSHIP 17-S RANGE 34-E N.M.P.M.		10. Field and Pool, or Wildcat Vacuum Clorietta
11. Elevation (Show whether DF, RT, GR, etc.) 3998' (GR)		12. County Lea

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK ☐ TEMPORARILY ABANDON ☐ PULL OR ALTER CASING ☐ OTHER ☐	PLUG AND ABANDON ☐ CHANGE PLANS ☐ REMEDIAL WORK ☐ COMMENCE DRILLING OPNS. ☐ CASING TEST AND CEMENT JOBS ☐ OTHER Perforate & Complete ☒

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- TOTAL DEPTH 6150'
PLUG BACK TOTAL DEPTH 6123'
13 3/8" OD 48# & 54.5# K-55 Csg Set @ 1575'
8 5/8" OD 32# & 24# S-80 & K-55 Csg Set @ 4850'
5 1/2" OD 15.5# K-55 Csg Set @ 6150'
- Perforate 5 1/2" Csg w/2-JSPF @ 6065', 72', 75', 87', 90', & 6094'.
 - Set pkr. @ 6000'. Acidize perfs 6065' - 6094' w/1000 Gals. 20% NEFE Acid & 12 Ball Sealers. Swab.
 - Squeeze perfs. 6065' - 6094' w/125 Sx. Class 'H' Cement containing 2% CaCl. PBTD 6060'.
 - Perforate 5 1/2" Csg w/2-JSPF @ 6029', 34', 38', 41', 44', 48' & 6054'.
 - Set pkr. @ 5964'. Acidize perfs. 6029' - 6054' w/1000 Gals. 20% NEFE Acid & 20 Ball Sealers. Swab.
 - Install pumping equipment & Test.
 - Pull pumping equipment. Set RBP @ 6020'. Pull tubing.
 - Perforate 5 1/2" Csg w/2-JSPF @ 5980', 83', 86', 6001' & 6003'.
 - Set pkr. @ 5930'. Acidize perfs. 5980' - 6003' w/1000 Gals. 20% NEFE Acid & 12 Ball Sealers.
 - Install pumping Equipment. Test & place on production 7-16-81.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED [Signature] TITLE Asst. Dist. Mgr. DATE 7-17-81

APPROVED BY _____ TITLE _____ DATE _____
CONDITIONS OF APPROVAL, IF ANY: