State of New Mexico Energ, inerals and Natural Resources Department

Form C-103

DISTRICT I P.O. Box 1980, Hobbs, NM 88240

OIL.	CONSERVATION	DIVISION
	DO Box 2088	

P.O. Box 2088 Santa Fe, New Mexico 87504-2088

Revised 1-1-89 WELL API NO. 30-025-27775

Santa Fe, New Mexico 87504-2088	5 Indicate Type of Lease					
DISTRICT II P.O. Drawer DD, Artesia, NM 88210	5. Indicate Type of Lease STATE FEE FEE					
DISTRICT III 1000 Rio Brazos Rd., Aziec, NM 87410	6. State Oil & Gas Lease No. A-4096					
	A-4090					
SUNDRY NOTICES AND REPORTS ON WELLS						
	7. Lease Name or Unit Agreement Name					
(FORM C-101) FOR SUCH PROPOSALS.)	NEW MEXICO "DD" STATE					
1 Type of Well:						
OIL GAS WELL OTHER						
2. Name of Operator	8. Well No.					
J & G ENTERPRISE LTD, CO.						
3. Address of Operator	9. Pool name or Wildcat SCHARB BONE SPRINGS					
J. AMHERICA ARM 99210	SOURTH DOME STREET					
P. O Box 100, ARTESIA, NM 88210	7 ፑለርጥ					
4. Well Location Unit Letter B 660 Feet From The NORTH Line and 194	Feet From The Line					
Unit Letter : Feet From The						
19S Pance 35E	NMPM LEA County					
Section Township 193 Range Section (Show whether DF, RKB, RT, GR, etc.)	\/////////////////////////////////////					
V/////////////////////////////////////	X/////////////////////////////////////					
Y/////////////////////////////////////	eport, or Other Data					
Check Appropriate Box to Indicate Nature of Notice, R	SEQUENT REPORT OF:					
NOTICE OF INTENTION TO:	SECULIAL FILL OFF OF					
BEMEDIAL WORK	ALTERING CASING					
PERFORM REMEDIAL WORK						
TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRILLING	GOPNS. L. PLUG AND ABANDONINEN					
CASING TEST AND CEMENT JOB						
PULL OR ALTER CASING L.						
UIDEN.	iding estimated date of starting any proposed					
12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, incli	——————————————————————————————————————					
work) SEE RULE 1103.						
25 av 101 7080's	-7754 '.					
1. 5-9 Circ. salt gel mud @ 3800'. Pump 25 sx C 7900' 2. 5-9 Weld on 5½" csg. Try to get off of slips. Cmt.	is 15"down inside 8 5/8".					
2. 5-9 Weld on 5½" csg. Try to get off of slips. Cmt. 3. 5-12 Bacilio Mendoza w/SBCP talked to Jack Griffin w/OC	CD; ok'd to lower cmt. volumes					
3. 5-12 Bacilio Mendoza w/SBCP talked to Jack Gillin w/oc	420'. Also added 25 sx "C"					
on 8 5/8" shoe plug @ 4000. & 13 5/6 shoe plug @ 11/20						
on 8 5/8" shoe plug e 4000 u love need to tag plugs. plug from 1750'to 1524! Do not need to tag plugs.	(Across 8 5/8" shoe).					
5 12 Circ salt gel mud. Pump 25 sx "C" 4000 = 3774 . (Meross = 5)						
5. 5-17 Lamb 72 27 27 27 27 27 27 27 27 27 27 27 27	· (IRELOSS I C)					
4 5_12 Pump 25 sx "C" from 420' - 194'. (Across 13 370')	· (IRELOSS I C)					
4 5_12 Pump 25 sx "C" from 420' - 194'. (Across 13 370')	· (IRELOSS I C)					
6. 5-12 Pump 25 sx "C" from 420" - 194". (Across 13 370". 7. 5-12 Pump 10 sx "C" from 30' to surface.	· (IRELOSS I C)					
4 5_12 Pump 25 sx "C" from 420' - 194'. (Across 13 370')	· (IRELOSS I C)					
6. 5-12 Pump 25 sx "C" from 420" - 194". (Across 13 370") 7. 5-12 Pump 10 sx "C" from 30' to surface.	· (IRELOSS I C)					
6. 5-12 Pump 25 sx "C" from 420" - 194". (Across 13 370") 7. 5-12 Pump 10 sx "C" from 30' to surface.	· (IRELOSS I C)					

I hereby certify that the jefformation above is true and complete to the best of my knowled	dge and belief. Agent		DATE	6-10-97
SIGNATURE ()			TELEPIK	NE NO.
TYPE OR PRINT NAME		700		
(This apace for State Use)	0.0		DATE —	<u> </u>
CONDITIONS OF APPROVAL, IF ANY:	mue			
COMPANIES.				2.1

JCM