

OIL CONSERVATION DIVISION

P. O. BOX 2088
SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-78

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.O.B.	
LAND OFFICE	
OPERATOR	

5a. Indicate Type of Lease	
State <input checked="" type="checkbox"/>	Fee <input type="checkbox"/>
5. State Oil & Gas Lease No.	
LG 889	

SUNDRY NOTICES AND REPORTS ON WELLS RECEIVED

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO OPEN OR PLUG BACK TO A DIFFERENT WELL. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER- <input type="checkbox"/>		7. Unit Agreement Name	
2. Name of Operator Fred Pool Drilling, Inc.		8. Farm or Lease Name Pearl State	
3. Address of Operator P. O. Box 1393, Roswell, NM 88202		9. Well No. 1	
4. Location of Well UNIT LETTER 0, 660 FEET FROM THE South LINE AND 1980 FEET FROM THE East LINE, SECTION 10 TOWNSHIP 19S RANGE 35E NMPM.		10. Field and Pool, or Wildcat Pearl Queen	
15. Elevation (Show whether DF, RT, GR, etc.)		12. County Lea	

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input checked="" type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPMS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>	

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

We intend to plug & abandon the subject well as follows:

- 1) Set CIBP @ 4900', place 35' cement cap on CIBP.
- 2) Load hole with 10# salt gel.
- 3) Shoot off 5½" casing @ 4300', recover 5½" casing.
- 4) Run 2 3/8" tubing to 4350±, (50" inside 5½" stub) and cover stub and 8 5/8" shoe (4080') with cement, tag plug.
- 5) Spot 100' cement plug accross base of salt @ 3200'.
- 6) Spot 100' cement plug accross top of salt @ 1990'.
- 7) Spot 10' surface plug.
- 8) Install regulation dry hole marker and clean location.
- 9) Work will commence upon approval of this procedure.

Note: All plugs to be class "C" cement.

THE COMMISSION MUST BE NOTICED 24 HOURS PRIOR TO THE BEGINNING OF PLUGGING OPERATIONS FOR THE WELL TO BE APPROVED.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Deborah Holusha TITLE Secretary DATE 6/21/88

ORIGINAL SIGNATURE OF SEXTON

APPROVED BY Deborah Holusha TITLE Secretary DATE 6/21/88

CONDITIONS OF APPROVAL, IF ANY: