

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

BLM • CARLSBAD
RECEIVED

MAY 26 11 03 AM '92

FORM APPROVED
Budget Bureau No. 1004-0135
Expires: September 30, 1990

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals

SUBMIT IN TRIPLICATE

1. Type of Well

☒ Oil Well ☐ Gas Well ☐ Other

2. Name of Operator

Lynx Petroleum Consultants, Inc.

3. Address and Telephone No.

P. O. Box 1979, Hobbs, NM 88241 505-392-6950

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

1980' FSL & 660' FEL, Section 9, T-19S, R-35E

5. Lease Designation and Serial No.

NM-0554858

6. If Indian, Allottee or Tribe Name

7. If Unit or CA, Agreement Designation

8. Well Name and No.

Government 9 #2

9. API Well No.

300252819100S1

10. Field and Pool, or Exploratory Area

Scharb Bone Spring

11. County or Parish, State

Lea County, NM

12. CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

- ☒ Notice of Intent
☐ Subsequent Report
☐ Final Abandonment Notice

TYPE OF ACTION

- ☒ Abandonment
☐ Recompletion
☐ Plugging Back
☐ Casing Repair
☐ Altering Casing
☐ Other

- ☐ Change of Plans
☐ New Construction
☐ Non-Routine Fracturing
☐ Water Shut-Off
☐ Conversion to Injection

(Note: Report results of multiple completion on Well Completion or
Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

1. MIRU WO unit. Unseat pump. POOH with rods and pump. NU BOP, test.
2. Release TAC. POOH with tbg. and TAC.
3. RIH with CIBP and tbg. Set CIBP @ + 9400' plus 35' (6 sxs) cement cap.
4. Circulate wellbore with 9.5 ppg gelled brine.
5. Set 600' cement plug (112 sxs) across 7" line top (3705') and 9 5/8" shoe (4135') from 3600-4200'. Tag plug.
6. Set ~~600~~ (17 sxs) cement plug across top salt 1575-~~1625~~ ¹⁶⁷⁵.
7. Set 100' (34 sxs) cement plug at 13 3/8" shoe 360-460'. TAG PLUG
8. Set 50' (17 sxs) cement plug @ surface.
9. Cut csg. 3' below ground. Weld on plate and P&A marker.
0. Remove battery equipment. Reseed with BLM seed mixture 1.

14. I hereby certify that the foregoing is true and correct

Signed

Max W. ...

Title President

Date

5/21/92

(This space for Federal or State office use)

Approved by

Adam ...

Title PETROLEUM ENGINEER

Date

6-1-92

Conditions of approval, if any:

NOTIFY BLM AT (505)393-3612 PRIOR TO ANY WORK.