

OIL CONSERVATION DIVISION

P. O. BOX 2088
SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-78

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

5a. Indicate Type of Lease State <input checked="" type="checkbox"/> Fee <input type="checkbox"/>
5. State Oil & Gas Lease No. B-4120-1

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER- 2. Name of Operator TEXACO Inc. 3. Address of Operator P. O. Box 728, Hobbs, New Mexico 88240 4. Location of Well UNIT LETTER E 2080 FEET FROM THE North LINE AND 989 FEET FROM West 8 LINE, SECTION 17-S RANGE 36-E NMPM. 15. Elevation (Show whether DF, RT, CR, etc.) 3896' (GR)	7. Unit Agreement Name - 8. Farm or Lease Name New Mexico 'AH' State 9. Well No. 13 10. Field and Pool, or Wildcat Undesignated 12. County
--	--

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>	

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

TOTAL DEPTH 9500'
20" OD 94# J-55 CSG (CONDUCTOR PIPE) SET @ 310'
13 3/8" OD 54# K-55 CSG SET @ 1950'
8 5/8" OD 24# & 32# S-80 & J-55 CSG SET @ 5200'.

1. Log Well. Test Well. No Show.
2. Spot 35 Sx. Cement plug from 9500'-9400'.
3. Spot 40 Sx. Cement plug from 8350'-8250'.
4. Spot 40 sx. Cement plug from 6100'-6000'.
5. Set CIBP @ 5160' & spot 20 Sx. Cement on top of plug from 5160'-5110'.
6. Spot 50 Sx. Cement plug from 4619'-4449'.
7. Spot 50 Sx. Cement plug from 1953'-1783'.
8. Spot 25 Sx. Cement plug from 63' - surface.
9. Install dry hole marker. Clean location. Well P & A 8-24-83.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED [Signature] TITLE Asst. Dist. Mgr. DATE 8-24-83

APPROVED BY

[Signature]

OIL & GAS INSPECTOR

FEB 23 1984

CONDITIONS OF APPROVAL, IF ANY:

RECEIVED
AUG 26 1983
D.C.D.
HOBBS OFFICE