

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO. 30-025-28234
5. Indicate Type of Lease STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name Norris
8. Well No. 1-13
9. Pool name or Wildcat S. Humble City (Strawn)
10. Elevation (Show whether DF, RKB, RT, GR, etc.)

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: --OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER	2. Name of Operator Bonneville Fuels Corporation
3. Address of Operator 1600 Broadway, Suite 1110, Denver, CO 80202	4. Well Location Unit Letter L : 330 Feet From The West Line and 1650 Feet From The South Line Section 13 Township 17S Range 37E NMPM Lea County

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☐
OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. POOH w/ rods & Tbg. Set CIBP @ 11,640' KB. Dump 4 sx. cmt. on top w/ WL or Tbg.
2. RIH w/ 2 7/8" Tbg. & Test csg. to 500 psig. Circ. csg. w/ MLF
3. Spot 100' plug (25 sx. neat cmt.) from 8600' - 8500'.
4. Spot 100' plug (25 sx. neat cmt.) from 7200' - 7100'.
5. Cut 5 1/2" csg. w/ Jet cutter @ 5350' & lay dwn.
6. Spot 100' plug (25 sx. neat cmt.) from 5400' - 5300'. (50' inside 5 1/2" & 50' out). plug @ tag stub.
7. Spot 100' plug (40 sx. neat cmt.) from 4757' - 4657'. (50' outside & 50' in 9 5/8" shoe).
8. Spot 100' plug (40 sx. neat cmt.) from 518' - 418'.
9. Spot 40' plug (15 sx. neat cmt.) from 40' - 0 (surface plug).
10. Cut off WH. Install dry hole marker. Cut off anchors. Restore location.

THE OIL CONSERVATION DIVISION MUST BE NOTIFIED
24 HOURS PRIOR TO COMMENCING WORK.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Gerald D. Gentry TITLE Operations Supervisor DATE 6/28/91
TYPE OR PRINT NAME (303) 863-1555
TELEPHONE NO.

(This space for State Use)

APPROVED BY _____ TITLE _____ DATE 02 1991
CONDITIONS OF APPROVAL, IF ANY: