

Submit 3 Copies  
to Appropriate  
District Office

State of New Mexico  
Energy, Minerals and Natural Resources Department

Form C-103  
Revised 1-1-89

DISTRICT I  
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II  
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III  
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION  
P.O. Box 2088  
Santa Fe, New Mexico 87504-2088

WELL API NO. 30-025-28257
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No. LG-740-3
7. Lease Name or Unit Agreement Name Vacuum State
8. Well No. 4
9. Pool name or Wildcat Scharb Bone Springs
10. Elevation (Show whether DF, RKB, RT, GR, etc.)

SUNDRY NOTICES AND REPORTS ON WELLS  
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A  
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"  
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:  
OIL WELL ☐ GAS WELL ☐ OTHER PLUG & ABANDON

2. Name of Operator  
YATES PETROLEUM CORPORATION

3. Address of Operator  
105 South 4th St., Artesia, NM 88210

4. Well Location  
Unit Letter I : 1980 Feet From The South Line and 660 Feet From The East Line  
Section 4 Township 19S Range 35E NMPM Lea County

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>
OTHER: <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
	CASING TEST AND CEMENT JOB <input type="checkbox"/>
	OTHER: <input type="checkbox"/>

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

CONTINUED FROM PREVIOUS PAGE:

Rigged up welder. Welded 5-1/2" pull nipple. Rigged up casing jacks. Could not pull enough to take slips off. Parted pull nipple with 380000#. Nippled up BOP. Shut down for night.

8-12-95 - TIH with tubing to 4100'. Spotted 97 bbls plug mud from 4100' to surface. Mixed and pumped 25 sacks Class C cement from 4100-3900'. POOH with tubing to 1915'. Mixed and pumped 25 sacks Class C cement from 1950-1715'. POOH with tubing. Nippled down BOP and wellhead. Rigged up welder. Welded 5-1/2" pull nipple. Rigged up wireline. TIH and cut 5-1/2" casing at 1000'. Could not pull casing. Pressured up to 1275# - no bleed off in 10 minutes. TIH and perforated 4 holes at 550'. Rigged down wireline. Pressured up to 1400# - no loss in 10 minutes. TIH with tubing to 1050'. Mixed and pumped 25 sacks Class C cement from 1050-850'. POOH with tubing to 600'. Mixed and pumped 25 sacks Class C cement from 600-400'. POOH with tubing to 50'. Mixed and pumped 10 sacks Class C cement from 50' to surface. POOH w/tubing. Nippled down BOP. Cleaned location.

Installed regulation abandonment marker. PLUGGED & ABANDONED - FINAL REPORT. P & A complete 8-10-95.

SIGNATURE Rusty Klein TITLE Production Clerk DATE Aug. 18, 1995

TYPE OR PRINT NAME Rusty Klein

TELEPHONE NO. 505/748-1471

(This space for State Use)

APPROVED BY Larry M. Hill TITLE SECRETARY DATE OCT 19 1995

CONDITIONS OF APPROVAL, IF ANY:

RECEIVED

AUG 2 1964

U.S. DEPARTMENT OF AGRICULTURE  
WASHINGTON, D.C.

**PLUG & ABANDONMENT FORM**

API NO. \_\_\_\_\_

OPERATOR \_\_\_\_\_

LEASE NAME \_\_\_\_\_

WELL NO. \_\_\_\_\_

SEC. \_\_\_\_\_

TWP. \_\_\_\_\_

RANGE \_\_\_\_\_

UNIT \_\_\_\_\_

Date plugging operations began - \_\_\_\_\_

Date plugging operations completed - \_\_\_\_\_

Name of plugging company - \_\_\_\_\_

Comments: \_\_\_\_\_

Signed By: \_\_\_\_\_

Date: \_\_\_\_\_