

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103  
Supersedes Old  
C-102 and C-103  
Effective 1-1-65

5a. Indicate Type of Lease	
State <input checked="" type="checkbox"/>	Fee <input type="checkbox"/>
5. State Oil & Gas Lease No.	
LG-2363	

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.  
USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	7. Unit Agreement Name
2. Name of Operator JFG Enterprise	8. Farm or Lease Name Arco State
3. Address of Operator P.O. Box 100, Artesia, NM 88210	9. Well No. 1
4. Location of Well UNIT LETTER <u>N</u> <u>660</u> FEET FROM THE <u>South</u> LINE AND <u>2120</u> FEET FROM THE <u>West</u> LINE, SECTION <u>16</u> TOWNSHIP <u>18-S</u> RANGE <u>32-E</u> NMPM.	10. Field and Pool, or Wildcat Young Bone Spring
15. Elevation (Show whether DF, RT, GR, etc.)	12. County Lea

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐  
TEMPORARILY ABANDON ☐  
PULL OR ALTER CASING ☐  
OTHER ☐

PLUG AND ABANDON ☐  
CHANGE PLANS ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐  
COMMENCE DRILLING OPNS. ☐  
CASING TEST AND CEMENT JOB ☐  
OTHER ☐  
ALTERING CASING ☐  
PLUG AND ABANDONMENT ☒

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

9-30-85 Set C.I.B.P. at 8860 ft. with 35 ft. cement on top.

10-7-85 Started up again. Having rig trouble. Shot casing off at 5510 ft. Pulled & laid down 5525 ft. 5 1/2" 17# & 20# N-80 Casing (overall). Run tubing in hole & spotted 50 sx. cement across 5 1/2" stub at top of Delaware Formation. Pulled up and let set.

10-9-85 Tagged plug at 5438 ft; Pulled up to 4060 ft; spotted 50 sx. plug across 9 5/8" shoe. Pulling tubing out and laying down.

10-10-85 Place 50 sx. plug from 800 ft. up. Cut surface and spotted 10 sx. plug at surface. Erected dry hole marker. Rigged unit down.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Eddie W. [Signature] TITLE Partner DATE 12-3-85

APPROVED BY Oil & Gas TITLE  DATE

CONDITIONS OF APPROVAL, IF ANY:

RECEIVED

DEC 4 - 1985

C. S. J.  
HOBBS LONDON