

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO. 30-025-29636
5. Indicate Type of Lease STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name CITIES SERVICE "15"
8. Well No. 1
9. Pool name or Wildcat Wildcat

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER Dry Hole <u>Re-entry</u>	
2. Name of Operator CHISOS OPERATING, INC.	
3. Address of Operator P. O. Box 10865, Midland, Texas 79702	
4. Well Location Unit Letter <u>L</u> : <u>1980</u> Feet From The <u>South</u> Line and <u>660</u> Feet From The <u>West</u> Line Section <u>15</u> Township <u>17-S</u> Range <u>37-E</u> NMPM <u>Lea</u> County	
10. Elevation (Show whether DF, RKB, RT, GR, etc.)	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>
OTHER: <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
	CASING TEST AND CEMENT JOB <input type="checkbox"/>
	OTHER: <input type="checkbox"/>

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. MIRU, set 4-1/2 CIBP at 8500' and cap w/7 sxs. cement.
2. Load hole w/ mud.
3. Cut and pull 4-1/2" csg. at 7673'.
4. Run tbg. and spot 35 sxs cmt at 7750'. WOC, tag at 7463'.
5. Spot 45 sxs. cmt. at 6704'.
6. Spot 40 sxs. cmt at 4550'. WOC, tag at 4455'.
7. Spot 30 sxs. cmt at 2230'.
8. Spot 30 sxs. cmt. at 456'.
9. Spot 10 sxs. cmt. at surface and P&A Marker.
10. Final cleanup of location has been completed.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Ron Gilbreath TITLE Vice President-Operations DATE 11/28/90

TYPE OR PRINT NAME / Ron Gilbreath

TELEPHONE NO. (915)686-9466

(This space for State Use)

APPROVED BY [Signature] TITLE OIL & GAS REGULATOR DATE DEC 18 1990

CONDITIONS OF APPROVAL, IF ANY:

R

E