STATE OF NEW MEXICO ENERGY AND MINERALS DEPARTMENT

	· · · · · · · · · · · · · · · · ·				
MB. OF COPICE ACCEIVED					
DISTRIBUTION					
SANTA FE					
FILE	1				
U.S.G.S.					
LAND OFFICE					
	, 				

OIL CONSERVATION DIVISION

SANTA FE			O. BOX 2088			Form C-103 Revised 10-1-7		
FILE		SANTAFE	, NEW MEXIC	20 87501		·····		
U.S.O.S.					Sa. Indicate T	ype of Lease		
DPERATOR					State X	Fee		
O'CHATON					B-1565	Gas Lease No.		
· · · · · · · · · · · · · · · · · · ·	SUNDRY NO	TICES AND DEDOD	TC ON WELLS			mmmm		
(00 NOT USE THIS	TORM FOR PROPOSAL	ITICES AND REPOR	. LO DIN MELLO Dr Plug back to a di I for such proposal	IFFERENT RESERVOIR.				
1.	. 🗀				7. Unit Agree	ment Name		
		#ER-						
2. Name of Operator					8. Farm or Le	ase Name		
Texaco Producing Inc. 3. Address of Operator						New Mexico "BM" State		
					9. Well No.			
P. O. Box 728, Hobbs, New Mexico 88240					1			
UNIT LETTER 0 330 FEET FROM THE SOUTH LINE AND 1652 FEET FRO						Pool, or Wildcat		
UNIT LETTER		FEET FROM THES	OUTT LINE AN	0 1652 FEET	Prom Double	A Abo Lower		
THE East	LINE, SECTION	16 TOWNSHIP	17S RANG	ge36En,	чем.			
mmmn	mmm	15. Elevation (Show	what a DE DE C	D		777/1/1/1/		
		3875.6' KB	whether Dr. KI, G	n, etc.)	12. County			
16.	Charle Asses	71			Lea			
NOT	Check Appro	priate Box To Indi	cate Nature of					
" NOT	ICE OF INTEN	110N 10:	į	SUBSEQUI	ENT REPORT O	F:		
PERFORM REMEDIAL WORK	$\overline{\mathbf{x}}$	PLUG AND ABAND	ON REMEDIAL	work				
TEMPORARILY ABANDON	=	•		E DRILLING OPHS.		G AND ABANDONMENT		
PULL OR ALTER CABING		CHANGE PLANS	r1	ST AND CEMENT JOB	700	S AND ABANDONMENT		
			OTHER					
OTHER			_ 🗆					
17. Describe Proposed or C	Completed Operation	s (Clearly state all nessis	ant details, and riv		J:			
work) SEE RULE 1103	•	o (oreart) state all pertin	iem Leidnis, and gri	re pertinent dates, includ	aing estimatea aate (of starting any proposed		
1) MIRU pull	ing unit. I	oull rods and pu	mp.					
	OP. Pull to							
 Perforate 42 holes) 	the follows	ng with 2 JSPF:	9236'-40',	58'-64', 68'-7	76' (21 inter	vals,		
		1/2" workstring	to † 02001					
	side to 1000		10 - 9200.					
		ons 40# crossli	nkad gallad	hring and 100 (200#			
as follow	's:	10110 1011 0100511	inca gerrea	Diffie and 120,0	JUU# sand			
<u>Stage</u>	Volume	#/gal. sand	# sand					
n- 4	20.000		•					
Pad 1	20,000 8,000	0	. 0					
2	8,000	2	8,000					
3	8,000	3 .	11,000 24,000					
4	8,000	4	32,000					
5	8,000	5	40,000					
			120,000	(OVER)				
8. I hereby certify that the	information above	s true and complete to the	e best of my knowle	edge and belief.	207 2577			
	1 al 1	,			397-3571			
IGHED James G	1 Head	DOW TITLE	Hobbs Are	a Superintenden	it DATE JI	uly 1, 1987		
· · · · · · · · · · · · · · · · · · ·		t til 🕡 🖫			21 #1	9 1007		
PPROVED BY			t		JUL	2 1987		

- Pump at 30 BPM and 7000# max. Flush to top perf.

7) Tag TD. Circulate hole clean if necessary.8) Tun tubing, rods and pump and place on production.