to Appropriate District Office		ew Mexico Iral Resources Department		Form C-103 Revised 1-1-8
DISTRICT I P.O. Box 1980, Hobbs, NM 85240	P.O. Bo		WELL API NO.	
DISTRICT II P.O. Drawer DD, Artesia, NM 88210	Santa Fe, New Me	exico 87504-2088	5. Indicate Typ	<u>30-025-29829</u>
DISTRICT III 1000 Rio Brazos Rd., Aziec, NM 87410	" PAGE 1 of 2		6. State Oil &	STATE FI
SUNDRY NO	TICES AND REPORTS ON		- vinninnin	
( DO NOT USE THIS FORM FOR PI DIFFERENT RESI	POPOSALS TO DRILL OR TO DE ERVOIR. USE "APPLICATION FO C-101) FOR SUCH PROPOSALS	EPEN OR PLUG BACK TO A	7. Lease Name	or Unit Agreement Name
1. Type of Well: OIL CAS WELL X WELL	] отнек	·		VIERSEN
2. Name of Operator PENNZOTI EXPLOP			8. Well No.	
3. Address of Operator	ATION & PRODUCTION (	COMPANY		3
•	0 – MIDLAND TX	79710-0090	9. Pool name o	r Wildcat SHIPP STRAWN
	0 Feet From The Sout	h Line and 20	)80 <b>Eest E</b> n	m Dant
,			080 Feet Fr	om The <u>East</u>
Section 4	Township 17S	Range 37E	NMPM	Lea c
	IV. Elevation (SNOW W	heiher DF, RKB, RT, GR, etc.) 3774.6 GR		
11. Check	Appropriate Box to India			
NOTICE OF IN	TENTION TO:			REPORT OF:
			DSEQUENT	REPORT OF:
	PLUG AND ABANDON			ALTERING CASING
	CHANGE PLANS		GOPNS.	PLUG AND ABANDONM
EMPORARILY ABANDON     Image: Construction of the second sec	CHANGE PLANS			PLUG AND ABANDONM
PULL OR ALTER CASING	CHANGE PLANS	CASING TEST AND C		
PULL OR ALTER CASING		CASING TEST AND C		
PULL OR ALTER CASING	ntions (Clearly state all pertinent det	CASING TEST AND C OTHER:	EMENT JOB	of starting any proposed
PULL OR ALTER CASING	ntions (Clearly state all pertinent deu	CASING TEST AND C OTHER:	EMENT JOB	of starting any proposed
PULL OR ALTER CASING DTHER: 12. Describe Proposed or Completed Oper work) SEE RULE 1103. 10-13-92 thru 11-11-9 at 10992' & spot 35'	<b>Nions (Clearly state all pertinent deu</b> 92 : Pull & Lay dow	CASING TEST AND C OTHER: ails, and give pertinent dates, incluent n pump, rods & 2-7 BP hack to 100571	EMENT JOB	of starting any proposed - Set 5-1/2" CIB
PULL OR ALTER CASING THER: 12. Describe Proposed or Completed Oper work) SEE RULE 1103. 10-13-92 thru 11-11-9 at 10992' & spot 35' hole with brine mud -	Dions (Clearly state all pertinent deu <u>92</u> : Pull & Lay dow cement on top of CI - Spot 25 sx Class -	CASING TEST AND C OTHER: oils, and give pertinent dates, inclu- n pump, rods & 2-7 BP back to 10957'	EMENT JOB	of starting any proposed - Set 5-1/2" CIB at 10957' & circ.
DULL OR ALTER CASING         DTHER:         12. Describe Proposed or Completed Oper work)         SEE RULE 1103.         10-13-92 thru 11-11-9         at 10992' & spot 35'         hole with brine mud - casing cutter - Top casing - Ran in hole	<b>ations (Clearly state all perimens det</b> <u>92</u> : Pull & Lay dow cement on top of CI - Spot 25 sx Class - of cement at 8042' - to 8042' & set 50 s	CASING TEST AND C OTHER: ails, and give pertinent dates, inclu- n pump, rods & 2-7 BP back to 10957' C- cement from 820 Cut casing at 799	EMENT JOB	of starting any proposed - Set 5-1/2" CIB at 10957' & circ. 8042' - Rig up 95 jts. 5-1/2"
PULL OR ALTER CASING         DTHER:         12 Describe Proposed or Completed Oper work) SEE RULE 1103.         10-13-92 thru 11-11-9         at 10992' & spot 35'         hole with brine mud - casing cutter - Top casing - Ran in hole         Tagged plug at 7910'	Ations (Clearly state all periment deu 92 : Pull & Lay dow cement on top of CI - Spot 25 sx Class - of cement at 8042' - to 8042' & set 50 s - Mixed 50 sx Class	CASING TEST AND C OTHER: ails, and give periment dates, incluent n pump, rods & 2-7 BP back to 10957' C- cement from 820 Cut casing at 799 x Class -C- cement	EMENT JOB	of starting any proposed - Set 5-1/2" CIB at 10957' & circ. 8042' - Rig up 95 jts. 5-1/2" ' to 7876' -
PULL OR ALTER CASING         DTHER:         12. Describe Proposed or Completed Oper work) SEE RULE 1103.         10-13-92 thru 11-11-92 at 10992' & spot 35'         hole with brine mud - casing cutter - Top casing - Ran in hole         Tagged plug at 7910'         Class -C- cement plug	Dions (Clearly state all perimens details) D2 : Pull & Lay dow cement on top of CI - Spot 25 sx Class - of cement at 8042' - to 8042' & set 50 s - Mixed 50 sx Class 4253' to 4083' - R	CASING TEST AND C OTHER: Dills, and give pertinent dates, inclu- n pump, rods & 2-7 BP back to 10957' C- cement from 820 Cut casing at 799 x Class -C- cement -C- cement plug 6	EMENT JOB	of starting any proposed - Set 5-1/2" CIB at 10957' & circ. 8042' - Rig up 95 jts. 5-1/2" to 7876' - 02' - Mix 50 sx.
PULL OR ALTER CASING         DTHER:         12. Describe Proposed or Completed Oper work) SEE RULE 1103.         10-13-92 thru 11-11-9         at 10992' & spot 35'         hole with brine mud - casing cutter - Top co casing - Ran in hole         Tagged plug at 7910'         Class -C- cement plug         Class -C- cement plug         to 4222' - Pump 8 sx	Thions (Clearly state all periment deu 92 : Pull & Lay dow cement on top of CI - Spot 25 sx Class - of cement at 8042' - to 8042' & set 50 s - Mixed 50 sx Class 5 4253' to 4083' - R 5 4190' to 3997 - Ray cottonseed bulls &	CASING TEST AND C OTHER: Dills, and give pertinent dates, inclu- pulls, and give pertinent dates, inclu- n pump, rods & 2-7 BP back to 10957' C- cement from 820 Cut casing at 799 x Class -C- cement -C- cement plug 6 an to 4190' - Did n to 4189' - Did n	EMENT JOB	of starting any proposed - Set 5-1/2" CIB at 10957' & circ. 8042' - Rig up 95 jts. 5-1/2" to 7876' - 02' - Mix 50 sx. ag - Mix 50 sx. 5 - Pumped LCM pi
PULL OR ALTER CASING         DTHER:         12. Describe Proposed or Completed Oper work)         SEE RULE 1103.         10-13-92 thru 11-11-9         at 10992' & spot 35'         hole with brine mud -         casing cutter - Top of casing - Ran in hole         Tagged plug at 7910'         Class -C- cement plug         Class -C- cement plug         to 4222' - Pump 8 sx         Mixed 25 sx Class -	Thions (Clearly state all perimens det 92 : Pull & Lay dow cement on top of CI - Spot 25 sx Class - of cement at 8042' - to 8042' & set 50 s - Mixed 50 sx Class 3 4253' to 4083' - R 3 4190' to 3997 - Rai cottonseed hulls & C- cement plug 4075	CASING TEST AND C OTHER: Dils, and give pertinent dates, inclu- n pump, rods & 2-7 BP back to 10957' C- cement from 820 Cut casing at 799 x Class -C- cement -C- cement plug 6 an to 4190' - Did n to 4189' - Did n 4 sx paper with 50 ' to 4006' - Bas d	EMENT JOB	of starting any proposed - Set 5-1/2" CIB at 10957' & circ. 8042' - Rig up 95 jts. 5-1/2" ' to 7876' - 02' - Mix 50 sx. ag - Mix 50 sx. c - Pumped LCM pi mud - Broke circ
PULL OR ALTER CASING	ations (Clearly state all periment deu 92 : Pull & Lay dow cement on top of CI - Spot 25 sx Class - of cement at 8042' - to 8042' & set 50 s - Mixed 50 sx Class 3, 4253' to 4083' - R 3, 4190' to 3997 - Ray cottonseed hulls & - C- cement plug 4075 ed up to 4222' - Mix	CASING TEST AND C OTHER: ails, and give pertinent dates, inclu- n pump, rods & 2-7 BP back to 10957' C- cement from 820 Cut casing at 799 x Class -C- cement -C- cement plug 6 an to 4190' - Did n to 4189' - Did n 4 sx paper with 50 ' to 4006' - Ran i	EMENT JOB wding estimated date /8" tubing - Tag TOC a 6' back to 2' & rec. 1 plug 8042' 349' to 620 not tag plug bbls brine n hole to 4	of starting any proposed - Set 5-1/2" CIB at 10957' & circ. 8042' - Rig up 95 jts. 5-1/2" ' to 7876' - 02' - Mix 50 sx. ag - Mix 50 sx. c - Pumped LCM pil a mud - Broke circ 378' - Did not ta
PULL OR ALTER CASING         DTHER:         12 Describe Proposed or Completed Oper work) SEE RULE 1103.         10-13-92 thru 11-11-9         at 10992' & spot 35'         hole with brine mud - casing cutter - Top of casing - Ran in hole         Tagged plug at 7910'         Class -C- cement plug         Class -C- cement plug         to 4222' - Pump 8 sx         Mixed 25 sx Class - plug at 4378' - Pulle         sx Class -C- cement plug	Alions (Clearly state all periment deu 22 : Pull & Lay dow cement on top of CI - Spot 25 sx Class - of cement at 8042' - to 8042' & set 50 s - Mixed 50 sx Class 3 (4253' to 4083' - R 3 (4190' to 3997 - Rai cottonseed hulls & C - cement plug 4075 ed up to 4222' - Mixed plug 4075' - Tagged a	CASING TEST AND C OTHER: ails, and give perinent dates, inclu- ails, and give perinent dates, inclu- ails, and give perinent dates, inclu- n pump, rods & 2-7 BP back to 10957' C- cement from 820 Cut casing at 799 x Class -C- cement -C- cement plug 6 an to 4190' - Did n to 4190' - Did n 4 sx paper with 50 ' to 4006' - Ran i ed LCM Pill - Had	EMENT JOB	of starting any proposed - Set 5-1/2" CIB at 10957' & circ. 8042' - Rig up 95 jts. 5-1/2" to 7876' - 02' - Mix 50 sx. ag - Mix 50 sx. ag - Pumped LCM pi mud - Broke circ 378' - Did not ta 60 bbls - Mix 30
PULL OR ALTER CASING	Ations (Clearly state all periment details) 22 : Pull & Lay down cement on top of CI - Spot 25 sx Class - of cement at 8042' - to 8042' & set 50 sc - Mixed 50 sx Class 33 (4253' to 4083' - R 34 (4190' to 3997 - Rational cottonseed hulls & C- cement plug 4075 ad up to 4222' - Mixed colug 4075' - Tagged to Called NMOCC - Had	CASING TEST AND C OTHER: Dills, and give pertiment dates, inclu- pails, and give pertiment dates, inclu- n pump, rods & 2-7 BP back to 10957' C- cement from 820 Cut casing at 799 x Class -C- cement -C- cement plug 6 an to 4190' - Did n to 4189' - Did n 4 sx paper with 50 ' to 4006' - Ran i ed LCM Pill - Had wet cement at 4127	EMENT JOB	of starting any proposed - Set 5-1/2" CIB at 10957' & circ. 8042' - Rig up 95 jts. 5-1/2" to 7876' - 02' - Mix 50 sx. 19 - Mix 50 sx. 19 - Mix 50 sx. 19 - Pumped LCM pi 10 - Broke circ 10 378' - Did not ta 10 60 bbls - Mix 30 Fent in hole to 42
PULL OR ALTER CASING         DTHER:         12 Describe Proposed or Completed Oper work) SEE RULE 1103.         10-13-92 thru 11-11-9         at 10992' & spot 35'         hole with brine mud - casing cutter - Top of casing - Ran in hole         Tagged plug at 7910'         Class -C- cement plug         Class -C- cement plug         to 4222' - Pump 8 sx         Mixed 25 sx Class - plug at 4378' - Pulle         sx Class -C- cement plug	D2 : Pull & Lay dow cement on top of CI - Spot 25 sx Class - of cement at 8042' - to 8042' & set 50 s - Mixed 50 sx Class 4253' to 4083' - R cottonseed hulls & C- cement plug 4075 d up to 4222' - Mixed called NMOCC - Had ( Pumped 10 sx cemen	CASING TEST AND C OTHER: Dils, and give pertinent dates, inclu- nils, and give pertinent dates, inclu- n pump, rods & 2-7 BP back to 10957' C- cement from 820 Cut casing at 799 x Class -C- cement -C- cement plug 6 an to 4190' - Did n to 4189' - Did n 4 sx paper with 50 ' to 4006' - Ran i ed LCM Pill - Had wet cement at 4127 OK from Mr. Jerry t plug 4145' to 41	EMENT JOB	of starting any proposed - Set 5-1/2" CIB at 10957' & circ. 8042' - Rig up 95 jts. 5-1/2" to 7876' - 02' - Mix 50 sx. 19 - Mix 50 sx. 19 - Mix 50 sx. 19 - Pumped LCM pi 10 - Broke circ 10 378' - Did not ta 10 60 bbls - Mix 30 Fent in hole to 42
PULL OR ALTER CASING	D2 : Pull & Lay dow cement on top of CI - Spot 25 sx Class - of cement at 8042' - to 8042' & set 50 s - Mixed 50 sx Class 4253' to 4083' - R cottonseed hulls & C- cement plug 4075 d up to 4222' - Mixed called NMOCC - Had ( Pumped 10 sx cemen	CASING TEST AND C OTHER: mils, and give pertiment dates, inclu- mils, and give pertiment dates, inclu- mils, and give pertiment dates, inclu- n pump, rods & 2-7 BP back to 10957' C- cement from 820 Cut casing at 799 x Class -C- cement -C- cement plug 6 an to 4190' - Did n to 4189' - Did n 4 sx paper with 50 ' to 4006' - Ran i ed LCM Pill - Had wet cement at 4127 DK from Mr. Jerry plug 4145' to 41 ge and belief.	EMENT JOB	of starting any proposed - Set 5-1/2" CIB at 10957' & circ. 8042' - Rig up 95 jts. 5-1/2" ' to 7876' - 02' - Mix 50 sx. ag - Mix 50 sx. ag - Mix 50 sx. ag - Mix 50 sx. ag - Mix 50 sx. bg - Mix 50 sx. content of the set set set set set set set set set se
PULL OR ALTER CASING         DTHER:         12. Describe Proposed or Completed Oper work) SEE RULE 1103.         10-13-92 thru 11-11-9         at 10992' & spot 35'         hole with brine mud -         casing cutter - Top of casing - Ran in hole         Tagged plug at 7910'         Class -C- cement plug         class -C- cement plug         to 4222' - Pump 8 sx         - Mixed 25 sx Class -         plug at 4378' - Pulle         sx Class -C- cement plug         class -C- cement plug         to 4222' - Pump 8 sx         - Mixed 25 sx Class -         plug at 4378' - Pulle         sx Class -C- cement plug         class -C- cement plug         sx Class -C- cement plug         bin not tag plug -         CIBP - Set at 4145' -         Ihereby certify that the information tag plug         SKONATURE	D2 : Pull & Lay dow cement on top of CI - Spot 25 sx Class - of cement at 8042' - to 8042' & set 50 s - Mixed 50 sx Class 4253' to 4083' - R cottonseed hulls & C- cement plug 4075 d up to 4222' - Mixed called NMOCC - Had ( Pumped 10 sx cemen	CASING TEST AND C OTHER: Dils, and give pertinent dates, inclu- nils, and give pertinent dates, inclu- n pump, rods & 2-7 BP back to 10957' C- cement from 820 Cut casing at 799 x Class -C- cement -C- cement plug 6 an to 4190' - Did n to 4189' - Did n 4 sx paper with 50 ' to 4006' - Ran i ed LCM Pill - Had wet cement at 4127 OK from Mr. Jerry t plug 4145' to 41	EMENT JOB	of starting any proposed - Set 5-1/2" CIB at 10957' & circ. 8042' - Rig up 95 jts. 5-1/2" ' to 7876' - 02' - Mix 50 sx. 19 - Mix 50 sx. 10 - Mix 50 sx.
PULL OR ALTER CASING         DTHER:         12. Describe Proposed or Completed Oper work) SEE RULE 1103.         10-13-92 thru 11-11-9         at 10992' & spot 35'         hole with brine mud -         casing cutter - Top of casing - Ran in hole         Tagged plug at 7910'         Class -C- cement plug         class -C- cement plug         to 4222' - Pump 8 sx         - Mixed 25 sx Class -         plug at 4378' - Pulle         sx Class -C- cement plug         class -C- cement plug         to 4222' - Pump 8 sx         - Mixed 25 sx Class -         plug at 4378' - Pulle         sx Class -C- cement plug         class -C- cement plug         sx Class -C- cement plug         bin not tag plug -         CIBP - Set at 4145' -         Ihereby certify that the information tag plug         SKONATURE	Thions (Clearly state all periment details) 22: Pull & Lay down cement on top of CI - Spot 25 sx Class - of cement at 8042' - to 8042' & set 50 sc - Mixed 50 sx Class 5, 4253' to 4083' - R 5, 4190' to 3997 - Rails cottonseed hulls & C- cement plug 4075 ed up to 4222' - Mixed Called NMOCC - Had ( - Pumped 10 sx cemen te and complete the best of my knowled Control of the best of my knowled	CASING TEST AND C OTHER: mils, and give pertinent dates, inclu- n pump, rods & 2-7 BP back to 10957' C- cement from 820 Cut casing at 799 x Class -C- cement -C- cement plug 6 an to 4190' - Did n to 4189' - Did n 4 sx paper with 50 ' to 4006' - Ran i ed LCM Pill - Had wet cement at 4127 DK from Mr. Jerry t plug 4145' to 41 ge and belief.	EMENT JOB	of starting any proposed - Set 5-1/2" CIB at 10957' & circ. 8042' - Rig up 95 jts. 5-1/2" ' to 7876' - 02' - Mix 50 sx. ag - Mix 50 sx. ag - Mix 50 sx. ag - Mix 50 sx. ag - Pumped LCM pi a mud - Broke circ 378' - Did not ta 60 bbls - Mix 30 ent in hole to 42 un & set 8-5/8" NUE ON NEXT PAGE DATE01/18/93 07 TELEPHONE NO.
PULL OR ALTER CASING         DTHER:         12. Describe Proposed or Completed Oper work) SEE RULE 1103.         10-13-92 thru 11-11-9         at 10992' & spot 35'         hole with brine mud -         casing cutter - Top of casing cutter - Top of casing - Ran in hole         Tagged plug at 7910'         Class -C- cement plug         class -C- cement plug         to 4222' - Pump 8 sx         - Mixed 25 sx Class -         plug at 4378' - Pulle         sx Class -C- cement plug         to 4222' - Pump 8 sx         - Mixed 25 sx Class -         plug at 4378' - Pulle         sx Class -C- cement plug         class -C- cement plug         to 4222' - Pump 8 sx         - Mixed 25 sx Class -         plug at 4378' - Pulle         sx Class -C- cement plug         class -C- cement plug         at 4145' -         Thereby certify that the informationation or is to a start of the plug -         SKONATURE       ROY R.	Thions (Clearly state all periment details) 22: Pull & Lay down cement on top of CI - Spot 25 sx Class - of cement at 8042' - to 8042' & set 50 sc - Mixed 50 sx Class 5, 4253' to 4083' - R 5, 4190' to 3997 - Rails cottonseed hulls & C- cement plug 4075 ed up to 4222' - Mixed Called NMOCC - Had ( - Pumped 10 sx cemen te and complete the best of my knowled Control of the best of my knowled	CASING TEST AND C OTHER: mils, and give pertiment dates, inclu- mils, and give pertiment dates, inclu- mils, and give pertiment dates, inclu- n pump, rods & 2-7 BP back to 10957' C- cement from 820 Cut casing at 799 x Class -C- cement -C- cement plug 6 an to 4190' - Did n to 4189' - Did n 4 sx paper with 50 ' to 4006' - Ran i ed LCM Pill - Had wet cement at 4127 DK from Mr. Jerry plug 4145' to 41 ge and belief.	EMENT JOB	of starting any proposed - Set 5-1/2" CIB at 10957' & circ. 8042' - Rig up 95 jts. 5-1/2" ' to 7876' - 02' - Mix 50 sx. 19 - Mix 50 sx. 10 - Mix 50 sx.
PULL OR ALTER CASING         DTHER:         12. Describe Proposed or Completed Oper work) SEE RULE 1103.         10-13-92 thru 11-11-9         at 10992' & spot 35'         hole with brine mud -         casing cutter - Top of casing cutter - Top of casing - Ran in hole         Tagged plug at 7910'         Class -C- cement plug         class -C- cement plug         to 4222' - Pump 8 sx         - Mixed 25 sx Class -         plug at 4378' - Pulle         sx Class -C- cement plug         to 4222' - Pump 8 sx         - Mixed 25 sx Class -         plug at 4378' - Pulle         sx Class -C- cement plug         class -C- cement plug         to 4222' - Pump 8 sx         - Mixed 25 sx Class -         plug at 4378' - Pulle         sx Class -C- cement plug         class -C- cement plug         at 4145' -         Thereby certify that the informationation or is to a start of the plug -         SKONATURE       ROY R.	Thions (Clearly state all periment details) 22: Pull & Lay down cement on top of CI - Spot 25 sx Class - of cement at 8042' - to 8042' & set 50 sc - Mixed 50 sx Class 5, 4253' to 4083' - R 5, 4190' to 3997 - Rails cottonseed hulls & C- cement plug 4075 ed up to 4222' - Mixed Called NMOCC - Had ( - Pumped 10 sx cemen te and complete the best of my knowled Control of the best of my knowled	CASING TEST AND C OTHER: mils, and give pertinent dates, inclu- n pump, rods & 2-7 BP back to 10957' C- cement from 820 Cut casing at 799 x Class -C- cement -C- cement plug 6 an to 4190' - Did n to 4189' - Did n 4 sx paper with 50 ' to 4006' - Ran i ed LCM Pill - Had wet cement at 4127 DK from Mr. Jerry t plug 4145' to 41 ge and belief.	EMENT JOB	of starting any proposed - Set 5-1/2" CIB at 10957' & circ. 8042' - Rig up 95 jts. 5-1/2" ' to 7876' - 02' - Mix 50 sx. ag - Mix 50 sx. ag - Mix 50 sx. ag - Mix 50 sx. ag - Pumped LCM pi a mud - Broke circ 378' - Did not ta 60 bbls - Mix 30 ent in hole to 42 un & set 8-5/8" NUE ON NEXT PAGE DATE01/18/93 07 TELEPHONE NO.

<u>+-</u> ·			1	
Submit 3 Copies to Appropriate District Office	State of New Mexico Energy, Minerals and Natural Resources Department		Form C-103 Revised 1-1-89	
DISTRICT I P.O. Box 1980, Hobbs, NM 88240	HODDA NM 88240 OIL CONSERVATION DIVISION		WELL API NO.	
DISTRICT II	P.O. Box 2088 <u>TII</u> wer DD, Artesia, NM 88210 TIII TIII		30-025-29829	
DISTRICT III			5. Indicate Type of Lease STATE FEE	
1000 Rio Brazos Rd., Aztec, NM 87410	" PAGE 2 of	2 "	6. State Oil & Gas Lease No.	
SUNDRY NOTICES AND REPORTS ON WELLS ( DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A				
DIFFERENT RESER	VOIR. USE "APPLICATION FOR PE 101) FOR SUCH PROPOSALS.)	N OR PLUG BACK TO A ERMIT	7. Lease Name or Unit Agreement Name	
1. Type of Well: OL GAS WELL A WELL	OTHER		VIERSEN	
2. Name of Operator PENNZOIL EXPLORA	TION & PRODUCTION COM	 PANY	8. Well No.	
3. Address of Operator			9. Pool name or Wildcat	
P. O. BOX 50090	- MIDLAND TX 79710-	-0090	SHIPP STRAWN	
4. Well Location				
Unit Letter0 : :	Feet From The South	Line and208	0 Feet From The East Line	
Section 4	Township 17S R	ange 37E	NMPM Lea County	
	10. Elevation (Show whether	DF, RKB, RT, GR, etc.)	NMPM Lea County	
	3774	4,6 GR		
11. Check A	Appropriate Box to Indicate	Nature of Notice, Re	eport, or Other Data	
	ENTION TO:		SEQUENT REPORT OF	
		REMEDIAL WORK	ALTERING CASING	
	CHANGE PLANS	COMMENCE DRILLING		
PULL OR ALTER CASING		CASING TEST AND CE		
OTHER:	□	OTHER:		
12. Describe Proposed or Completed Operat work) SEE RULE 1103.	io <b>as</b> (Clearly state all pertinent details, a	nd give pertinent dates, includ	ling estimated date of starting any proposed	
11-11-92 thru 11-18-92	2: Had good circulati	on = Pull out of	E hole to 2032' - Pumped	
	L DING TROM 2037, FO I	$\mathbf{W}\mathbf{W}\mathbf{U} = \mathbf{D}\mathbf{w}\mathbf{e} + \mathbf{e}\mathbf{v}\mathbf{e}$		
	Leu casing our or hold	I = Ron in hole .		
	Lue $0 = 1/0$ since Philip			
cement plug - 50' inside 8-5/8" stub - Pull out of hole & WOC - Went in hole with tubing & tagged TOC at 1063' - Set cement plug from 1063' to 954' - Pump 50 sx.				
$r_{\rm rement}$ program 400 = rumped (0' surface plug = Cut of the day is a start and the				
marker - Fill in well head - Cover pits - Remove fence - Cut off dead men - Well was P & A 11-18-92 - "FINAL REPORT"				
P & A 11-18-02 - "TETM	I PEDODUU	emove fence - Cu	it off dead men - Well was	

a A 11-18-92	LTHUT	<b>VELOVI</b>	٠	٠

I hereby certify that the information above is true and complete to the best of my knowledg	e and belief.	·
SKONATURE Tay A. Anno	meSr_Accountant	DATE
TYPE OR PRINT NAME ROY R. JOHNSON	915-689-8907	TELEPHONE NO.
(This space for State Use) APPROVED BY Hack Ariffin	UL & CLS INSPECTO	DR MAR 0 1 1993
CONDITIONS OF APPROVAL, IF ANY:	- TITLE	DATE TIME V 1 1000