

STATE OF NEW MEXICO
ENERGY AND MINERALS DEPARTMENT

OIL CONSERVATION DIVISION
P. O. BOX 2088
SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-78

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.O.S.	
LAND OFFICE	
OPERATOR	

5a. Indicate Type of Lease
State ☒ Fee ☐

5. State Oil & Gas Lease No.
B-1506

SUNDRY NOTICES AND REPORTS ON WELLS

DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	7. Unit Agreement Name
2. Name of Operator ARCO Oil and Gas Company	8. Farm or Lease Name Shoe Bar 23 State Com
3. Address of Operator P.O. Box 1610, Midland, Texas 79702	9. Well No. 1
4. Location of well UNIT LETTER <u>E</u> <u>660</u> FEET FROM THE <u>West</u> LINE AND <u>1980</u> FEET FROM THE <u>North</u> LINE, SECTION <u>23</u> TOWNSHIP <u>17S</u> RANGE <u>35E</u> NMPM.	10. Field and Pool, or Wildcat Undesignated Abo
15. Elevation (Show whether DF, RT, GR, etc.) 3927.7 GR	12. County Lea

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>	OTHER <input checked="" type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- 10-1-87. RU PU. POH w/CA. Set CIBP at 11,930. dumped 35' cmt. on top. Press test csg. & CIBP to 1000#. Perf Strawn f/11,650-11,660. Acidize w/1260 gals. Swab test. Total recovered 12.5 BO.
- 10-7-87. Set CIBP at 11,600 w/35' cmt. Press test to 1000#, perf Abo f/9591-9617. Acidize w/295 gals. Swab test. In 12 hrs swabbed 7 BO, 1.4 BFU, Fair gas blow. Acidize w/2400 gals. Swab test.
- 10-16-87. In 8 1/2 hrs swabbed 16 BO, 15 BFW, trace of gas. Total rec. 169 BO.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Ken A. Gosnell TITLE Engr. Tech. 915-688-5672 DATE 7-18-88

ORIGINAL SIGNATURE OF ENERGY COMMISSIONER

APPROVED BY PT. 10-1-88 TITLE PT. 10-1-88 DATE PT. 10-1-88

CONDITIONS OF APPROVAL, IF ANY:

2 A 8 Shoe Bar Abo 8