

STATE OF NEW MEXICO
ENERGY AND MINERALS DEPARTMENT

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.O.B.	
LAND OFFICE	
OPERATOR	

OIL CONSERVATION DIVISION
P. O. BOX 2088
SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-78

5a. Indicate Type of Lease State ☒ Fee ☐
5. State Oil & Gas Lease No. 41487

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. ☒ OIL WELL ☐ GAS WELL ☐ OTHER-	7. Unit Agreement Name
2. Name of Operator Texaco Producing Inc.	8. Form or Lease Name N.M. "O" State (Nct-1)
3. Address of Operator P.O. Box 728, Hobbs, New Mexico 88240	9. Well No. 26
4. Location of Well UNIT LETTER <u>M</u> <u>990</u> FEET FROM THE <u>South</u> LINE AND <u>990</u> FEET FROM THE <u>West</u> LINE, SECTION <u>36</u> TOWNSHIP <u>17-S</u> RANGE <u>34-E</u> NMPM.	10. Field and Pool, or Whidcat Vacuum Glorieta
15. Elevation (Show whether DF, RT, CR, etc.) 4014' KB	12. County Lea

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☐	REMEDIAL WORK ☒	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPS. ☐	PLUG AND ABANDONMENT ☐
PULL OR ALTER CASING ☐	OTHER ☐	CASING TEST AND CEMENT JOB ☐	OTHER ☐

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. MRO. Pull pump and rods. Install BOP. Pull tubing.
2. Set 5-1/2" cement retainer at 6106' on wireline.
3. String into retainer with tubing. Squeezed perfs at 6114'-6142' with 50 sacks class "H", 15.6 ppg. Maximum pressure 500 psi. Reversed out 3-1/2 sacks cement.
4. Spot 200 gallons 10% acetic acid at 5906'-6106'. POH.
5. Perforate Glorieta 2 SPI at 6046, 48, 80, 82, 84, 90, 96, 98 (8 intervals, 16 holes).
6. Set packer at 5966'. Acidize with 2500 gallons 15% NEFE. Average rate 3.6 BPM at 2500 psi. Maximum pressure 3000 psi, ISIP O.
7. Swab. POH with packer and tubing.
8. Run production equipment. 24 hour OPT 9-2-87: pumped 17 BO, 252 BW, gas TSTM.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED A. Gernandt 393-4031 TITLE Area Superintendent DATE 9-14-87

ORIGINAL SIGNED BY JERRY SEXTON

APPROVED BY DISTRICT 1 SUPERVISOR

TITLE

SEP 16 1987

CONDITIONS OF APPROVAL, IF ANY:

RECEIVED
SEP 15 1961
OCD
HOBB'S OFFICE