

DISTRICT I

P.O. Box 1980, Hobbs, NM 88240

DISTRICT II

P.O. Box Drawer DD, Artesia, NM 88210

DISTRICT III

1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088

Santa Fe, New Mexico 87504-2088

WELL API NO.

30-025-30104

5. Indicate Type of Lease

STATE ☒

FEE ☐

6. State Oil / Gas Lease No.

B-1565

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT
(FORM C-101) FOR SUCH PROPOSALS.

1. Type of Well: OIL WELL ☐ GAS WELL ☐ OTHER WIW

2. Name of Operator
TEXACO EXPLORATION & PRODUCTION INC.

3. Address of Operator
205 E. Bender, HOBBS, NM 88240

4. Well Location
Unit Letter A : 90 Feet From The NORTH Line and 706 Feet From The EAST Line
Section 36 Township 17S Range 34E NMPM LEA COUNTY

10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3993' GR

7. Lease Name or Unit Agreement Name

CENTRAL VACUUM UNIT

8. Well No. 242

9. Pool Name or Wildcat
VACUUM GRAYBURG SAN ANDRES

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐
OTHER: ☒

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☒ ALTERING CASING ☐
COMMENCE DRILLING OPERATION ☐ PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☐
OTHER: ☒ CONVERT TO INJECTION

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

2-17-00: MIRU. NDWH. NUBOP. TIH W/BIT, DC'S. PU WH. TAG UP @ 4212'. DISPL W/10# BRINE.
2-18-00: DRILL CMT 4212-4224'. DRILL CIBP @ 4224'. CIBP TURN LOOSE. PSH TO 4242'. CIRC OFF GAS & OIL.
2-21-00: LOWER BIT FR 4224-4455'. TAG UP. PSH CIBP TO 4719'. CIRC CLN. TIH W/PKR, SN, TBG. SET PKR @ 4220'.
2-22-00: ACIDIZE VGSAU FORMATION FR 4278-4720 W/12,000 GALS 20% NEFE HCL ACID & 6000# RK SLT. RU SWAB. FL @ 1100'. END FL @ 4100'.
2-23-00: FL @ 3800'. END FL @ 4100'. REL PKR @ 4200'. TIH W/BIT, TBG. TAG @ 4640'. CIRC GAS OFF. C/O 4640-4719'.
2-24-00: TIH W/PUMP OUT PLUG, PKR, ON/OFF TOOL & TBG. TEST TBG TO 5000 PSI. PKR SWING @ 4234'.
2-25-00: SET PKR @ 12' KB @ 4246'. REL ON/OFF TOOL. CIRC W/PKR FLUID, LATCH ON/OFF TOOL. L NDBOP. NU CO2 TREE. CIW TEST WH TO 3000 PSI. TEST CSG & PKR TO 500 PSI FOR 30 JMIN-CHART FOR NMOC-D-OK. RIG DOWN.
4-26-00: ON 24 HR OPT. INJ'G 601 BWPD @ 826 PSI. FINAL REPORT

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE J. Denise Leake TITLE Engineering Assistant

DATE 5/8/00

TYPE OR PRINT NAME J. Denise Leake

Telephone No. 397-0405

(This space for State Use)

APPROVED

CONDITIONS OF APPROVAL, IF ANY: _____ TITLE _____

DATE

MAY 24 2000
DeSoto/Nichols 12-93 ver 1.0

