

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

SUBMIT IN TRIPLICATE*
(Other instructions on re-
verse side)

Form approved.
Budget Bureau No. 1004-0135
Expires August 31, 1985

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

OIL WELL ☒ GAS WELL ☐ OTHER ☐

2. NAME OF OPERATOR

Harvey E. Yates Company

3. ADDRESS OF OPERATOR

P.O. Box 1933, Roswell, New Mexico 88202

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*
See also space 17 below.)

At surface

330' FNL & 990' FWL
Unit Letter D

14. PERMIT NO.

30-025-30266

15. ELEVATIONS (Show whether DF, RT, OR, etc.)

3781.8 GL

5. LEASE DESIGNATION AND SERIAL NO.

NM-55145

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Querecho Plains 22 Fed.

9. WELL NO.

#1

10. FIELD AND POOL, OR WILDCAT

Young Bone Springs

11. SEC., T., R., M., OR BLK. AND
SURVEY OR AREA

Sec. 22, T18S, R32E

12. COUNTY OR PARISH

Lea

13. STATE

NM

16.

Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

FRACTURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL

(Other)

PULL OR ALTER CASING

MULTIPLE COMPLETION

ABANDON*

CHANGE PLANS

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other) P&A

REPAIRING WELL

ALTERING CASING

ABANDONMENT*

(NOTE: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

7/20/89 Set CIBP @ 6950'. Dumped 35' of cmt on top. Ray Smith w/OCD witnessed plug being set & dump runs. Set CIBP @ 6050'. GIH w/tbg open ended & spot 35' cmt on top plug. Circ hole w/9.5# mud.

7/21/89 Pull tbg to 2870' & spot 100' cmt plug. POOH. GIH & shoot 5 1/2" csg off @ 1200'. Lay down csg. GIH & spot 100' cmt plug @ 1250'. POOH.

7/22/89 GIH & tag plug @ 1120'. Pull tbg to 900' & spot 100' plug. Pull tbg to 450' & pmp 100' plug. Pull tbg to 50' & spot 50' surface plug. Cut off WH & install dry hole marker. P&A complete @ 1:00 pm 7/22/89.

18. I hereby certify that the foregoing is true and correct

SIGNED Ray Nokes

TITLE Production Manager

DATE 7/24/89

(This space for Federal or State office use)

APPROVED BY Shannon J. Brown
CONDITIONS OF APPROVAL, IF ANY:

FOR CHIEF, MINERAL RESOURCES

TITLE

DATE 7.31.89

Approved by the Bureau of Land Management

Leasing Unit or Bureau is retained until

surface restoration is completed.

*See Instructions on Reverse Side