

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

Oil Cons. Div.
P.O. Box 1980
Hobbs, NM 88241

FORM APPROVED
Budget Bureau No. 1004-0135
Expires: March 31, 1993

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals

SUBMIT IN TRIPLICATE

1. Type of Well

☒ Oil Well ☐ Gas Well ☐ Other

2. Name of Operator

Yates Energy Corporation

3. Address and Telephone No.

P. O. Box 2323 - Roswell, NM 88202 505/623-4935

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

1980' FNL - 1980' FEL Sec. 17, T19S, R33E

5. Lease Designation and Serial No.

NM-077004

6. If Indian, Allottee or Tribe Name

8. Well Name and No.

Hudson Federal #1

9. API Well No.

30-025-30546

10. Field and Pool, or Exploratory Area

Gem, Morrow

11. County or Parish, State

Lea County, New Mexico

12. CHECK APPROPRIATE BOX(S) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

- ☐ Notice of Intent
☒ Subsequent Report
☐ Final Abandonment Notice

TYPE OF ACTION


- ☒ Abandonment
☐ Recompletion
☐ Plugging Back
☐ Casing Repair
☐ Altering Casing
☐ Other

- ☐ Change of Plans
☐ New Construction
☐ Non-Routine Fracturing
☐ Water Shut-Off
☐ Conversion to Injection
☐ Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

1/8/98 Circulate hole w/10# mud.
1/8/98 Spot 25 sks "C" cement @ 8410'.
1/9/98 Cut off 5 1/2" casing @ 5480' at free point. POOH w/casing.
1/10/98 Spot 35 sks "C" cement @ 5535'. WOC and tag top @ 5380' (5 1/2" stub plug).
1/13/98 Spot 50 sks "C" cement @ 5260'. WOC and tag top @ 5074' (8-5/8" shoe plug).
1/13/98 Spot 50 sks "C" cement @ 2500' to 2307'.
1/13/98 Spot 50 sks "C" cement @ 470' to 277'.
1/13/98 Spot 20 sks "C" cement @ 60' to surface.
1/19/98 Cut off wellhead and install dry hole marker.

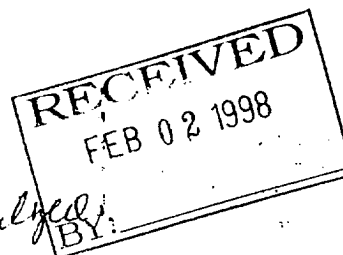

14. I hereby certify that the foregoing is true and correct.

Signed *David R. Glass*

SNG Well Plugging and Abandonment Services, LLC
Title President

Date 1/19/98

(This space for Federal or State office use)

(ORIG. SGD.) DAVID R. GLASS

Title PETROLEUM ENGINEER

Date

APR 23 1998

Approved by
Conditions of approval, if any: