

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO. 30-025-31204
5. Indicate Type of Lease STATE ☒ FEE ☐
6. State Oil & Gas Lease No. NM-878
7. Lease Name or Unit Agreement Name CENTRAL VACUUM UNIT
8. Well No. 345
9. Pool name or Wildcat VACUUM GRAYBURG SAN ANDRES

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: OIL WELL ☒ GAS WELL ☐ OTHER ☐	
2. Name of Operator TEXACO EXPLORATION AND PRODUCTION INC.	
3. Address of Operator P. O. Box 3109 Midland, Texas 79702	
4. Well Location Unit Letter <u>N</u> : <u>1310</u> Feet From The <u>SOUTH</u> Line and <u>1850</u> Feet From The <u>WEST</u> Line Section <u>31</u> Township <u>17-SOUTH</u> Range <u>35-EAST</u> NMPM LEA County <u></u>	
10. Elevation (Show whether DP, RKB, RT, GR, etc.) GR-3986', KB-4001'	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data
NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☐
OTHER: COMPLETING ☒

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. MIRU XPRT. CLEAN OUT TO PBTD OF 4750'. TESTED CASING TO 3000# FROM 11-11:30am 06-01-91. (30 MIN)
2. HALLIBURTON RAN GR-CBL-CCL. PERF w/ 2 JSPF: 4632-36, 4639-41, 4644-46, 4650-52, 4686-90. 30 HOLES.
3. TIH & SET RBP @ 4625'. TESTED TO 3000#. PERF w/ 2 JSPF: 4514-25, 4583-90. 36 HOLES. HALLIBURTON ACIDIZED w/ 2500 GAL 15% NEFE. SWAB 78 BLW IN 5 HRS. 06-07-91.
4. TIH & MOVED RBP TO 4500'. TESTED TO 3000#. PERF w/ 2 JSPF: 4426-31, 4436-39, 4450-49, 4467-71. 42 HOLES. HALLIBURTON ACIDIZED w/ 2700 GAL 15% NEFE. SWAB 55 BLW IN 2 HRS. 06-12-91.
5. TIH & MOVED RBP TO 4420'. TESTED TO 3000#. PERF w/ 2 JSPF: 4309-13, 4367-73, 4384-88, 4397-4403, 4407-10. 46 HOLES. HALLIBURTON ACIDIZED w/ 2700 GAL 15% NEFE. SWAB 47 BLW IN 3.5 HRS. 06-22-91.
6. TESTING.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE C.P. Basham / cwt

TITLE DRILLING OPERATIONS MANAGER

DATE 06-24-91

TYPE OR PRINT NAME C. P. BASHAM

TELEPHONE NO. 915-6884620

(This space for State Use)
ORIGINAL SIGNED BY JERRY SEXTON
DISTRICT I SUPERVISOR

APPROVED BY _____

TITLE _____

DATE _____

CONDITIONS OF APPROVAL, IF ANY: