

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO. 30-025-31373 ✓
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No. E-1190

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/> P&A <input type="checkbox"/>	7. Lease Name or Unit Agreement Name Little Maggie AJN State
2. Name of Operator YATES PETROLEUM CORPORATION	8. Well No. 1
3. Address of Operator 105 South 4th St., Artesia, NM 88210	9. Pool name or Wildcat Young Strawn
4. Well Location Unit Letter <u>I</u> : <u>2310</u> Feet From The <u>South</u> Line and <u>990</u> Feet From The <u>East</u> Line Section <u>16</u> Township <u>18S</u> Range <u>32E</u> NMPM Lea County	
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3875' GR	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>
OTHER: <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
	CASING TEST AND CEMENT JOB <input type="checkbox"/>
	OTHER: <input type="checkbox"/>

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Well plugged and abandoned as follows:

Set CIBP at 10275' cap with 35' cement.

Set CIBP at 7150' cap with 35' cement.

Set CIBP at 5825' cap with 35' cement.

Set CIBP at 4525' cap with 35' cement

RIH with wireline to 2987'. Cut 5-1/2" casing. Laid down 70 joints.

Spot 35 sx cement plug at 3037', across 5-1/2" stub. SDON. Tag TOC at 2862'.

Spot 10 sx cement plug at surface.

Set P&A marker. PLUGGING COMPLETED 5-5-93.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Juanita Goodlett TITLE Production Supervisor DATE 5-6-93
TYPE OR PRINT NAME Juanita Goodlett TELEPHONE NO. 505/748-1471

(This space for State Use)

APPROVED BY Sam Hill TITLE State Engineer DATE FEB 15 1994
CONDITIONS OF APPROVAL, IF ANY: