

DISTRICT I  
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II  
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III  
1000 Rio Brazos Rd., Aztec, NM 87410

**OIL CONSERVATION DIVISION**  
P.O. Box 2088  
Santa Fe, New Mexico 87504-2088

WELL API NO. 30-025-31473
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No. V-3762
7. Lease Name or Unit Agreement Name Perseus 26 State
8. Well No. 1
9. Pool name or Wildcat Spencer (Penn)

**SUNDRY NOTICES AND REPORTS ON WELLS**  
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER	2. Name of Operator Maralo, Inc.	3. Address of Operator P. O. Box 832, Midland, TX 79702	4. Well Location Unit Letter <u>G</u> : <u>1980</u> Feet From The <u>East</u> Line and <u>1980</u> Feet From The <u>North</u> Line Section <u>26</u> Township <u>17S</u> Range <u>36E</u> NMPM <u>Lea</u> County
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3827'			

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	
<b>NOTICE OF INTENTION TO:</b>	<b>SUBSEQUENT REPORT OF:</b>
PERFORM REMEDIAL WORK <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>
OTHER: <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
	CASING TEST AND CEMENT JOB <input type="checkbox"/>
	OTHER: <input type="checkbox"/>

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

2-3-93 PU & GIH w/ 158 jts tbg CIBP @ 10,010. Mix & circ 10# mud laden fluid. Jack Griffin, OCD on location.

2-4-93 POH w/ 2 7/8" tbg to 7512'. Load hole w/10# mud laden fluid. Mix & pump 25 sx Cl. "C" cement & displace w/43 bbls. 10# mud. RU WL. Set CIBP @ 4900' & dump 35' cement on top of plug. GIH w/ 2 7/8" tbg to 4800'. Load & circ hole w/10# mud laden fluid. Pull tbg up hole to 4500'.

2-5-93 Pump 25 sx Cl. "C" cement @ 4537'. Displace hole w/26 bbls 10# mud laden fluid. RU WL. GIH w/GL charge & cut csg @ 3137'. TOH w/76 jts 5 1/2" csg. GIH w/100 jts 2 7/8" tbg to 3172'. Pump 50 sx Cl. "C" cement plug @ csg stub 50' in & 50' out. Buddy Hill, OCD witnessed 1st plug.

2-8-93 GIH w/20 jts. 2 7/8" tbg. Tag csg stub plug @ 3078'. OCD rep ok'd. Pumped 50 sx plug @ 1504'. Displaced hole w/8.5 bbls 10# mud laden fluid. TOH in singles. Pumped 50 sx plug @ 450'. Displaced hole w/2.5 bbls 10# mud laden fluid. TOH in singles. Cut 13 3/8" + 8 5/8" wellheads off. Set 5 sx plug @ surface. Installed dry hole marker. Cut off dead men. Well P & A'd.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Dorothea Owens TITLE Agent DATE February 16, 1993

TYPE OR PRINT NAME Dorothea Owens TELEPHONE NO. 915 684-7441

(This space for State Use)

APPROVED BY Fanny M. Hill TITLE Oil & Gas Field Manager DATE MAR 25 1993

CONDITIONS OF APPROVAL, IF ANY: