

Submit 3 Copies  
to Appropriate  
District Office

State of New Mexico  
Energy, Minerals and Natural Resources Department

Form C-103  
Revised 1-1-89

**DISTRICT I**

P.O. Box 1980, Hobbs, NM 88240

**DISTRICT II**

P.O. Drawer DD, Artesia, NM 88210

**DISTRICT III**

1000 Rio Brazos Rd., Aztec, NM 87410

**OIL CONSERVATION DIVISION**

P.O. Box 2088  
Santa Fe, New Mexico 87504-2088

WELL API NO. 30-025-32003
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No. LG-607
7. Lease Name or Unit Agreement Name Redhawk "32" State
8. Well No. 2
9. Pool name or Wildcat Quail Ridge

<b>SUNDRY NOTICES AND REPORTS ON WELLS</b> (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	
2. Name of Operator Mitchell Energy Corporation	
3. Address of Operator Box 4000, The Woodlands, TX 77387	
4. Well Location Unit Letter <u>J</u> : <u>1980</u> Feet From The <u>South</u> Line and <u>1980</u> Feet From The <u>East</u> Line Section <u>32</u> Township <u>19S</u> Range <u>34E</u> NMPM <u>Lea</u> County <u></u>	
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3661' GR	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

**NOTICE OF INTENTION TO:**

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐  
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐  
PULL OR ALTER CASING ☐  
OTHER: ☐

**SUBSEQUENT REPORT OF:**

REMEDIAL WORK ☐ ALTERING CASING ☐  
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☒  
CASING TEST AND CEMENT JOB ☐  
OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- 5/3/94 MIRU Pride WS. Bled well down. ND tree. POOH w/tbg. Set CIBP @ 9700'.  
5/4 RIH w/bailer & dumped 5 sx cmt on CIBP. RIH w/tbg. Loaded hole w/9# mud.  
5/5 Free pt csg. Showed free @ 8500'. Cut csg @ 8486'. Could not pull free.  
5/6-7 Cut csg @ 7926'. Could not pull free. Cut csg @ 7486'. POOH w/5½" csg. RIH w/tbg to 5180'.  
5/10 RIH w/tbg to 8536'. Spot 25 sx cmt plug. PU to 8012'. Spot 30 sx cmt plug. PU to 7545'. Spot 30 sx cmt plug across csg cut. POOH w/tbg. WOC. RIH w/tbg & tagged plug @ 7463'. PU to 5300'. Spot 30 sx plug. PU tbg.  
5/11 Tagged plug @ 5243'. Respotted 16 sx cmt to cover 8½" shoe @ 5255'. PU to 3170'. Spot 30 sx cmt plug. PU to 1000'. Spot 30 sx cmt plug. POOH w/tbg. Spot 10 sx surf plug. Cut off WH. Weld on P&A marker. Cleaned location.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE

*James Blount*  
Jim Blount

Engineer

TITLE

DATE

5/18/94

TYPE OR PRINT NAME

TELEPHONE NO.

(915) 682-5396

(This space for State Use)

APPROVED BY

*Johnny Robinson*

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY

**RECEIVED**

**MAY 23 1994**

**JOBS  
OFFICE**