

DISTRICT I

P.O. Box 1980, Hobbs, NM 88240

DISTRICT II

P.O. Box Drawer DD, Artesia, NM 88210

DISTRICT III

1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088

Santa Fe, New Mexico 87504-2088

WELL API NO.

30-025-32450

5. Indicate Type of Lease

STATE ☐

FEE ☐

6. State Oil / Gas Lease No.

7. Lease Name or Unit Agreement Name

NEW MEXICO O STATE NCT-1

8. Well No.

37

9. Pool Name or Wildcat

VACUUM GLORIETA

SUNDY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT
(FORM C-101) FOR SUCH PROPOSALS.

1. Type of Well: OIL WELL ☒ GAS WELL ☐ OTHER ☐

2. Name of Operator
TEXACO EXPLORATION & PRODUCTION INC.

3. Address of Operator
205 E. Bender, HOBBS, NM 88240

4. Well Location

Unit Letter I : 1650 Feet From The SOUTH Line and 330 Feet From The EAST Line

Section 36 Township 17-S Range 34-E NMPM LEA COUNTY

10. Elevation (Show whether DF, RKB, RT,GR, etc.)

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐

TEMPORARILY ABANDON ☐ CHANGE PLANS ☐

PULL OR ALTER CASING ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☒ ALTERING CASING ☐

COMMENCE DRILLING OPERATION ☐ PLUG AND ABANDONMENT ☐

CASING TEST AND CEMENT JOB ☐

OTHER: ☐ Recomplete to Glorieta

* Change NAME

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

10-27-99: MIRU. NDWH. NUBOP.

10-28-99: CUT PARAFFIN. RUN FREE PT. TBG STUCK @ 7270'. CUT TBG @ 7288'. CUT TBG @ 7255'. TBG STUCK @ 6985'. CUT TBG @ 6933'. WORK TBG LOOSE. TIH W/OVERSHOT, GRAPPLE, BS, JARS & DC'S.

10-29-99: TIH TO 6804'. OVERSHOT TO 6934'. TIH W/SHOE, WP, JARS & DC'S TO 6350'.

10-30-99: TIH W/SHOE & WP TO 6900'. BREAK CIRC. WASHOVER SCALE 6900-6936' TOP OF FISH. WASH OVER 6936-6968'. TIH W/OVERSHOT, GRAPPLE, DC'S ON TBG. STOP OVERSHOT @ 6250'.

11-01-99: TIH W/OVERSHOT TO 6936'. CATCH FSH. JAR ON FSH. MOVE FSH 26' W/20' FREE TRAVEL.

11-02-99: TIH W/SAME TOOLS. CATCH FSH @ 6936'. JAR ON FSH.

11-03-99: TOP OF FSH @ 7240'. TIH W/TBG FOR KILL STRING.

11-04-99: TIH W/BIT, CSG SCRAPER, TBG TO 6411'. TIH W/CIBP & SET @ 6343'. LOAD, TEST TO 500 PSI-OK. CHART FOR NMOCD.

11-08-99: TIH W/LOG TOOL. TAG CIBP @ 6336'. RAN GR/CCL/CML LOG FR 6336-5300. TIH W/PERF GUN. PERF GLORIETA 5908-5925, 5930-50, 5955-80.

11-09-99: FINISH PERF JOB. TIH W/PERF GUN & PERF 5890-5925. TIH W/DUMP BAILER. CAP CIBP @ 6336' W/35' CMT. NEW PBTD @ 6301'.

TIH W/PKR, SN, TEST TBG TO 5000 PSI. PSA 5827'. ACIDIZE PERFS 5890-5980' W/6000 GALS 15% NEFE HCL ACID.

11-10-99: RU SWAB. FL @ 300'. END FL @ 5700'.

11-11-99: FL @ 4500'. SWAB DRY. REL PKR. TIH TO 6127'. CIRC W/FW. PULL PKR TO 5822'. REL PKR.

11-15-99: TIH W/PERF GUN & PERF 6000-16,6030-40,6058-68. TIH W/PKR, SN ON TBG. SET PKR @ 5772'. TEST CSG TO 5000-OK.

11-16-99: ACIDIZE 5890-6068 W/5000 GALS 15% NEFE ACID.

11-17-99: FL @ 3500'. END FL @ 5700'.

11-19-99: REL PKR. TIH W/OPMA, SN, TBG. TIH W/2 7/8" TBG. NDBOP. SET TAC. NUWH. OPMA @ 6134'. SN @ 6103'. TAC @ 5814'.

11-23-99: TIH W/GAS ANCHOR, PUMP, K-BARS, RDS. HANG WELL ON. LOAD/TEST. PUMPING @ 3:30 PM

11-29-99: ON 24 HR OPT. PUMPED 28 BO, 57 BW, & 43 MCF. FINAL REPORT

* Change NAME to Vacuum Glorieta West Unit #189

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE *J. Denise Leake* TITLE Engineering Assistant

DATE 12/8/99

TYPE OR PRINT NAME J. Denise Leake

Telephone No. 397-0405

(This space for State Use)

APPROVED

CONDITIONS OF APPROVAL, IF ANY:

TITLE

DATE

DeSola/Nichols 12-93 ver 1.0

Vacuum Drinkard
2A Vacuum Bline dry