

DISTRICT I

P.O. Box 1980, Hobbs, NM 88240

DISTRICT II

P.O. Box Drawer DD, Artesia, NM 88210

DISTRICT III

1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088

Santa Fe, New Mexico 87504-2088

WELL API NO.

30-025-32799

5. Indicate Type of Lease

STATE ☒

FEE ☐

6. State Oil / Gas Lease No.

B-1861

7. Lease Name or Unit Agreement Name

CENTRAL VACUUM UNIT

8. Well No.

186

9. Pool Name or Wildcat

VACUUM GRAYBURG SAN ANDRES

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT
(FORM C-101) FOR SUCH PROPOSALS.

1. Type of Well: OIL WELL ☒ GAS WELL ☐ OTHER

2. Name of Operator
TEXACO EXPLORATION & PRODUCTION INC.

3. Address of Operator
205 E. Bender, HOBBS, NM 88240

4. Well Location

Unit Letter O : 607 Feet From The SOUTH Line and 2630 Feet From The EAST Line

Section 31 Township 17-S Range 35-E NMPM LEA COUNTY

10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3976' GR

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐

PLUG AND ABANDON ☐

TEMPORARILY ABANDON ☐

CHANGE PLANS ☐

PULL OR ALTER CASING ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐

COMMENCE DRILLING OPERATION ☐ PLUG AND ABANDONMENT ☐

CASING TEST AND CEMENT JOB ☐

OTHER: CLEAN OUT & ACIDIZE ☒

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1-18-00: MIRU. NDWH. NUBOP. REL TAC. RU SWAB. SWAB DN TBG. TIH W/TBG FOR KILL STRING TO 1525'. TAG BTM @ 4606'. 57' SAND FILL O9N TOP OF CIBP.

1-19-00: RU REV UNIT. TIH W/NEW BIT, DC'S. PU WS. TAG @ 4606'. BREAK CIRC. C/O SAND & SCALE TO CIBP @ 4658'. DRILL ON CIBP. PULL BIT TO 4118'.

1-20-00: LOWER TOOLS & TAG CIBP @ 4658'. BREAK CIRC W/190 BBLs. DRILL ON CIBP. TURN LOOSE. PUSH TO 4709'. STOP. TIH W/CONE BUSTER MILL, DC'S ON TBG. STOP MILL @ 4144'.

1-21-00: LOWER TBG & TOOLS TO 4711'. TIH W/25 STANDS FOR KILL STRING.

1-24-00: TIH W/MILL, DC'S. TAG @ 47122'. BREAK CIRC. MILL ON JUNK 4712-4713.5'. TIH W/KILL STRING TO 1520'.

1-25-00: TIH W/MILL, TBG. TAG @ 4713'. MILL ON CIBP. JUNK @ 4713-4715'. C/O TO 4728'.

1-26-00: TIH W/MILL, TBG TO 4715'. RATATE THRU BAD CSG TAG UP @ 4728'. MILL ON JUNK. PSH TO 4766'. PULL MILL TO 4122'.

1-27-00: LOWER MILL & TAG UP @ 4766'. MILL ON JUNK TO 4798'. RUN MULESHOE JT, STRING MILL, DC'S, JARS, TBG.

1-28-00: TIH W/STRING MILL TO 4712'. MILL THRU BAD SPOT 4712-4716, TIH TO 4795'. TAG UP SOLID. TIH W/BIT, DC'S, TBG TO 4795'.

1-31-00: TIH W/PERF GUN, PERF 4706-4722'. TIH W/PKR, SN, TBG. PSA 4214'.

2-01-00: ACIDIZE PERFS 4291-4722 W/10,000 GALS 20% NEFE HCL. RU SWAB. FL @ SURF. END FL @ 1300'.

2-02-00: FL @ 1000'. END FL @ 1400'. CHEM SQZ PERFS 4291-4722 W/20 GALS ALPHA 160 BIOCID, MIXED W/10 BFW.

2-03-00: REL PKR. TIH W/BIT ON PROD TBG. TAG SALT FILL @ 4720'. C/O SALT FILL 4720-4795. PULL BIT TO 4250'. TIH W/OLD RDS.

2-04-00: TIH W/TBG BULL PLUGGED, GAS SEPR, SN, WRKNG BBL SUB, TAC, TBG. TBG @ 4760'. SN @ 4722'. TAC @ 4211'. NDBOP. NUWH.

2-07-00: TIH W/STAND VALVE, PLGR. RUN K BARS, RDS. RIG DOWN. PUMPING @ 4.2 SPM @ 288" STROKE.

3-01-00: ON 24 HR OPT. PUMPED 35 BO, 1124 BW, & 47 MCF. PERFS 4291-4722. VACUUM GRAYBURG SAN ANDRES

FINAL REPORT

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE *J. Denise Leake* TITLE Engineering Assistant

DATE 3/7/00

TYPE OR PRINT NAME J. Denise Leake

Telephone No. 397-0405

(This space for State Use)

APPROVED

CONDITIONS OF APPROVAL, IF ANY: TITLE

DATE MAR 20 2000
DeSoto/Nichols 12-93 ver 1.0