

DISTRICT I

P.O. Box 1980, Hobbs, NM 88240

DISTRICT II

P.O. Box Drawer DD, Artesia, NM 88210

DISTRICT III

1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088

Santa Fe, New Mexico 87504-2088

WELL API NO.	30-025-33850
5. Indicate Type of Lease	STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil / Gas Lease No.	B-1056-1
7. Lease Name or Unit Agreement Name	NEW MEXICO Q STATE
8. Well No.	12
9. Pool Name or Wildcat	VACUUM WOLFCAMP
10. Elevation (Show whether DF, RKB, RT, GR, etc.)	3998' GR

SUNDRY NOTICES AND REPORTS ON WELL
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:	OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>
2. Name of Operator	TEXACO EXPLORATION & PRODUCTION INC.
3. Address of Operator	205 E. Bender, HOBBS, NM 88240
4. Well Location	Unit Letter <u>O</u> : <u>400</u> Feet From The <u>SOUTH</u> Line and <u>1900</u> Feet From The <u>EAST</u> Line Section <u>25</u> Township <u>17-S</u> Range <u>34-E</u> NMPM <u>LEA</u> COUNTY
10. Elevation (Show whether DF, RKB, RT, GR, etc.)	3998' GR

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☒ ALTERING CASING ☐
COMMENCE DRILLING OPERATION ☐ PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☐
OTHER: ☐ WOLFCAMP RECOMPLETION ☒

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

2-08-99: MIRU. JAR 1 HR TO UNSEAT PUMP. TOH W/LINER, RDS, SNKR BARS, & PMP. CUT PARAFFIN 2000' TO SURF. KILL WELL W/35 BBLS 2% KCL WTR. NDWH. NUBOP.
2-09-99: TIH W/BIT & CSG SCRAPER ON 2 7/8" TBG TO 10,248'. CUT PARAFFIN. TOH W/TBG.
2-10-99: MIRU SCH/LOG. TIH W/PERF GUN & PERF WOLFCAMP FORMATION 9310-32, 9340-60, 9516-34, 9558-64, 9578-80, 9630-78'. TIH W/RBP, PKR & SN. TEST 2 7/8" TBG TO 5000 PSI TO 8493'.
2-11-99: KILL WELL W/15 BBLS 2% KCL. TIH W/TBG. SET RBP @ 9808'. PULL PKR TO 9777'. CIRC W/212 BLS 2% KCL. SET PKR & TEST RBP TO 1000 PSI-OK. PULL PKR TO 9678'. SPOT 8 BBLS ACID FR 9678-9310'. PULL PKR TO 9244'. SET PKR & PSI CSG TO 500 PSI-OK. ACIDIZE WOLFCAMP PERFS FR 9310-9678' W/13,000 GALS 15% NEFE HCL & 200 BALL SEALERS. RIG UP SWAB. FL @ 2500'. END FL @ 3000'.
2-12-99: BLED DOWN. FL @ 2700'. SWAB. END FL @ 3600'.
2-13-99: BLED DN. SWAB. END FL @ 3500'. RU PUMP TRUCK. KILL W/25 BBLS 2% KCL. REL PKR. PKR HUNG UP @ 6924'. LEFT 3 SLIP SEGMENTS OFF PKR IN HLE. TIH W/OPMA, PERF SUB, SN, TBG, TAC. KB @ 20'. MA @ 9785'. SN @ 9750'. TAC @ 9187'. NDBOP. SET TAC. NUWH.
2-15-99: CUT PARAFFIN. TIH W/GAS ANCHOR, PMP, K-BARS, & RDS. HANG WELL ON. LOAD & TEST. CHECK PUMP ACTION-OK. WELL PUMPING @ 5:00 PM.
2-16-99: RIG DOWN.
2-24-99: ON 24 HR OPT. PUMPING 323 BO, 23 BW, & 555 MCF. WOLFCAMP PERFS: 9310-9678'.
FINAL REPORT

WILL DHC AND SEND IN SPLITS {DHC ORDER #2150}

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE J. Denise Leake TITLE Engineering Assistant DATE 2/25/99
TYPE OR PRINT NAME J. Denise Leake Telephone No. 397-0405

(This space for State Use)

APPROVED BY _____ TITLE _____ DATE _____
CONDITIONS OF APPROVAL, IF ANY: _____