

DISTRICT I

P.O. Box 1980, Hobbs, NM 88240

DISTRICT II

P.O. Box Drawer DD, Artesia, NM 88210

DISTRICT III

1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088

Santa Fe, New Mexico 87504-2088

WELL API NO.	30-025-34668
5. Indicate Type of Lease	STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil / Gas Lease No.	
7. Lease Name or Unit Agreement Name	NORTH VACUUM ABO WEST UNIT
8. Well No.	29
9. Pool Name or Wildcat	VACUUM ABO NORTH
10. Elevation (Show whether DF, RKB, RT, GR, etc.)	4057'

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT (FORM C-101) FOR SUCH PROPOSALS.

1. Type of Well:	OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>
2. Name of Operator	TEXACO EXPLORATION & PRODUCTION INC.
3. Address of Operator	205 E. Bender, HOBBS, NM 88240
4. Well Location	Unit Letter <u>O</u> : <u>365</u> Feet From The <u>SOUTH</u> Line and <u>1880</u> Feet From The <u>EAST</u> Line Section <u>21</u> Township <u>17-S</u> Range <u>34-E</u> NMPM <u>LEA</u> COUNTY
10. Elevation (Show whether DF, RKB, RT, GR, etc.)	4057'

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☒ ALTERING CASING ☐
COMMENCE DRILLING OPERATION ☐ PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☐
OTHER: ☒ pull whipstock & drill CIBP

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

5-12-00: MIRU. RU REV UNIT. NDWH. NUBOP.
5-15-00: TIH W/HOOK ASSEMBLY, BMPR SUB, JARS, DC'S. TAG @ 8713'. WRK TBG & ROTATE 1 HR. INSTL STRIPPER HEAD.
5-16-00: PUMP 50 BBLs TO KILL WELL. LOWER TOOLS & TAG WHIPSTOCK @ 8713'. TIH W/BOX TAP, SAFETY SUB, SMPR SUB, JARS, DC'S. TAG @ 8704'. WORK TOOLS TO 8709'. ROTATE & CAUGHT WHIPSTOCK.
5-17-00: RECVD 13" OF TOP OF WHIPSTOCK.
5-18-00: TIH W/BOX TAP, BMPR SUB, JARS, ETC. TAG TOP OF WHIPSTOCK @ 8708'. CAUGHT WHIPSTOCK. PULL UP HLE 12'. PULL LOOSE. TIH W/SHOE, JARS, DC'S. TAG @ 8694'. COULD NOT BREAK CIRC. PUMP 350 BW. START MILLING. MADE 1' TO 8695'. PULL TO 8670'.
5-19-00: PUMP 100 BFW DN TBG. LOWER TOOLS & MILL @ 8695'. WHIPSTOCK IS SPINNING.
5-22-00: TIH W/OVERSHOT, BMPR SUB, JARS, DC'S ON TBG TO 8701'. CAUGHT WHIPSTOCK & PSH TO 8711'. JAR LOOSE. RECVD WHIPSTOCK. TIH W/SHOE, DC'S. TAG @ 8722'. DRY DRILLING. C/O 4' SAND. MILL ON CIBP @ 8730'. TURN LOOSE PSH TO 8757'. PULL SHOE TO 8686'.
5-23-00: LOWER TBG. PSH CIBP TO 8788'. MILL TO 8850'. TIH W/OVERSHOT, JARS, DC'S. TAG @ 8849'. JAR OFF @ 20,000#.
5-24-00: TIH W/CONE BUSTER MILL, DC'S ON TBG. RAG @ 8849'. MILL 3' TO 8852'. CIBP SPINNING.
5-25-00: TIH W/ECOMETER, SN, TBG, TAC. TOOL @ 8820'. SN @ 8814'. TAC @ 8615'. NDBOP. NUWH. TIH W/PMP & RDS. LOAD & TEST.
5-26-00: RIG DOWN.
6-09-00: ON 24 HR OPT. PUMPED 106 BO, 52 BW, & 103 MCF.
FINAL REPORT

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE J. Denise Leake TITLE Engineering Assistant DATE 6/26/00
TYPE OR PRINT NAME J. Denise Leake Telephone No. 397-0405

(This space for State Use)

APPROVED

CONDITIONS OF APPROVAL IF ANY: ORIGINAL STORED BY C. J. WILLIAM TITLE DISTRICT ENGINEER DATE 6/26/00

