Submit 3 Copies To Appropriate District State of New Mexico Office	Form C-103
District I 1625 N. French Dr., Hobbs, NM 88240 Energy, Minerals and Natural Re	sources Revised March 25, 1999 WELL API NO.
District II OIL CONSERVATION DIV	ISION 30-025-35447
District III 2040 South Pacheco	5. Indicate Type of Lease
1000 Rio Brazos Rd., Aztec, NM 87410 District IV Santa Fe, NM 87505	STATE FEE
2040 South Pacheco, Santa Fe, NM 87505	6. State Oil & Gas Lease No. 26917
SUNDRY NOTICES AND REPORTS ON WELLS	7. Lease Name or Unit Agreement Name:
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BAC DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCI	TT
PROPOSALS.)	Sparkle Dunn "23"
1. Type of Well: Oil Well 🔲 Gas Well 🔲 Other Dry Hole	
2. Name of Operator	8. Well No.
David H. Arrington Oil & Gas, Inc	2
<ol> <li>Address of Operator</li> <li>P.O. Box 2071, Midland, Texas 79702</li> </ol>	9. Pool name or Wildcat
4. Well Location	Vacuum; Blinebry, NE
Unit Letter A :330'feet from theNorth line	and480'feet from theEastline
Section 23 Township 17S Ran	ge 35E NMPM County Lea
10. Elevation (Show whether DR, RKE	
3919' GR ; 3937' KB; 3936' DI	
11. Check Appropriate Box to Indicate Nature	-
	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK D PLUG AND ABANDON REM	
TEMPORARILY ABANDON CHANGE PLANS COM	MENCE DRILLING OPNS. DPLUG AND
	ABANDONMENT
COMPLETION	ENT JOB
OTHER: OTH	ER:
12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation.	
5/03/01- Set CIBP @ 7550', cap with 20 sxs of cmt & circ hole with mud. Spot 25 sxs @ 6700'. 5/04/01- Spot 25 sxs @ 4700', spot 25 sxs @ 2900' & tag TOC 2640'.	
5/07/01- Weld on pull nipple, stretch casing free point @ 6600'.	
5/09/01- RU reverse unit. Drill out plug @ 2900' & 4700'.	
5/10/01- Weld on pull nipple. Cut casing @ 6200' & POH with casing.	
5/14/01- Spot 40 sxs stub plug @ 6250' & tag TOC @ 6130'.	
5/15/01- Spot 40 sxs @ 4700' & tag TOC @ 4590'. Spot 40 sxs @ 2900', did not tag plug. 5/16/01- Spot 60 sxs @ 2900' & tag plug @ 2870'. Spot 60 sxs @ 2870' & tag plug @ 2795'.	
5/17/01- Spot 50 sxs @ 2500 & tag plug @ 2870 . Spot 60 sxs @ 2870 & tag plug @ 2755 . 5/17/01- Spot 50 sxs plug @ 1850' & tag TOC @ 1745'.	
5/17/01- Spot 50 sxs plug @ 1850' & tag TOC @ 1745'.	
5/17/01- Spot 50 sxs plug @ 1850' & tag TOC @ 1745'. 5/18/01- Spot 40 sxs plug @ 520'. Spot 10 sxs surface plug. Cut off v	
5/18/01- Spot 40 sxs plug @ 520'. Spot 10 sxs surface plug. Cut off	wellhead. Weld on dry hole marker.
	wellhead. Weld on dry hole marker.
5/18/01- Spot 40 sxs plug @ 520'. Spot 10 sxs surface plug. Cut off v I hereby certify that the information above is true and complete to the best of	wellhead. Weld on dry hole marker.
5/18/01- Spot 40 sxs plug @ 520'. Spot 10 sxs surface plug. Cut off v I hereby certify that the information above is true and complete to the best of SIGNATURE	wellhead. Weld on dry hole marker. my knowledge and belief.
5/18/01- Spot 40 sxs plug @ 520'. Spot 10 sxs surface plug. Cut off v I hereby certify that the information above is true and complete to the best of SIGNATURE	wellhead. Weld on dry hole marker. my knowledge and belief. gineerDATE_5/23/01
5/18/01- Spot 40 sxs plug @ 520'. Spot 10 sxs surface plug. Cut off v I hereby certify that the information above is true and complete to the best of SIGNATURE	wellhead. Weld on dry hole marker.  my knowledge and belief.  gineerDATE_5/23/01  Telephone No. (915) 682-6685
5/18/01- Spot 40 sxs plug @ 520'. Spot 10 sxs surface plug. Cut off v I hereby certify that the information above is true and complete to the best of SIGNATURE	wellhead. Weld on dry hole marker. my knowledge and belief. gineerDATE_5/23/01
5/18/01- Spot 40 sxs plug @ 520'. Spot 10 sxs surface plug. Cut off v I hereby certify that the information above is true and complete to the best of SIGNATURE	wellhead. Weld on dry hole marker.  my knowledge and belief.  gineerDATE_5/23/01  Telephone No. (915) 682-6685
5/18/01- Spot 40 sxs plug @ 520'. Spot 10 sxs surface plug. Cut off v I hereby certify that the information above is true and complete to the best of SIGNATURE	wellhead. Weld on dry hole marker. my knowledge and belief. gineerDATE_5/23/01 Telephone No. (915) 682-6685