

STATE OF NEW MEXICO
ENERGY AND MINERALS DEPARTMENT

NO. OF COPIES RECEIVED		
DISTRIBUTION		
SANTA FE		
FILE		
U.S.O.S.		
LAND OFFICE		
OPERATOR		

OIL CONSERVATION DIVISION
P. O. BOX 2088
SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-73

5a. Indicate Type of Lease
State ☒ Fee ☐
5. State Oil & Gas Lease No.
E-7418

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO GREEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. <input checked="" type="checkbox"/> OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER	7. Unit Agreement Name W. Pearl Queen Unit
2. Name of Operator Gulf Oil Corporation	8. Farm or Lease Name
3. Address of Operator P. O. Box 670, Hobbs, NM 88240	9. Well No. 105
4. Location of Well UNIT LETTER A 660 FEET FROM THE North LINE AND 810 FEET FROM THE East LINE, SECTION 29 TOWNSHIP 19S RANGE 35E N.M.P.M.	10. Field and Pool, or Wildcat Pearl Queen
11. Elevation (Show whether DF, RT, GR, etc.) 3755' GL	12. County Lea

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ OTHER ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☒
CASING TEST AND CEMENT JOB ☐ OTHER ☐

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work, SEE RULE 1103.

Circulate with abandonment mud. Cap CIBP at 4740' with 35' cement. Spot 100' cement plug 3300'-3200'. Perf 1850' with (4) 1/2" JH with 90° phasing. Set packer at 1798'. Pump through perfs, had slight blow on 13-3/8" casing first 10-12 bbls, then no blow on 70 bbls. Set cement retainer at 1798'. Cement 5 1/2" casing annulus with 400 sacks Class "H" cement with 16% gel followed by 100 sacks Class "C" neat. Run temperature survey TSTOC 900'. Circulate with abandonment mud. Set 50' surface plug. Set dry hole marker, clean and clean location and cut off anchors. P&A complete 1-18-81.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED RD Pite TITLE Area Engineer DATE 1-20-81

APPROVED BY Al H. [Signature] TITLE OIL & GAS INSPECTOR DATE MAY 20

CONDITIONS OF APPROVAL, IF ANY: