

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103  
Supersedes Old  
C-102 and C-103  
Effective 1-1-65

5a. Indicate Type of Lease
State <input checked="" type="checkbox"/> Fee <input type="checkbox"/>
5. State Oil & Gas Lease No.

**SUNDRY NOTICES AND REPORTS ON WELLS**  
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.  
USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER- <b>Injection Well</b>	7. Unit Agreement Name
2. Name of Operator <b>Shell Oil Company</b>	8. Farm or Lease Name <b>East Pearl Queen Unit</b>
3. Address of Operator <b>P. O. Box 1509 - Midland, Texas 79701</b>	9. Well No. <b>47</b>
4. Location of Well UNIT LETTER <b>L</b> , <b>1980</b> FEET FROM THE <b>South</b> LINE AND <b>660</b> FEET FROM THE <b>West</b> LINE, SECTION <b>35</b> TOWNSHIP <b>19-S</b> RANGE <b>35-E</b> NMPM.	10. Field and Pool, or Wildcat <b>Pearl Queen</b>
15. Elevation (Show whether DF, RT, GR, etc.) <b>3697 DF</b>	12. County <b>Lea</b>

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data  
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input checked="" type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>	OTHER <input type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- Set retainer 50' above shallowest perforations and squeeze with approximately 100 sacks regular cement. (Squeeze 80 sacks through perforations, leave cement to top of retainer and at least 20' of cement above retainer.)
- Shoot and pull casing from as deep as possible.
- Spot 100 sacks cement from top of casing stub upwards (dependent on hole size this should be from 150' to 200' of cement plug).
- Spot 75 sacks cement at top of salt section (based on 11" hole size this should give 150' of cement plug).  
Note: If casing cannot be pulled from no deeper than 1500', the casing should be perforated at the top of the salt section, 75 sacks squeezed through the perforations, and 100' of cement left inside the casing.
- Spot 75 sacks cement from 50' below surface casing upwards. This plug should extend 50 feet above shoe of surface casing.
- Spot 10' cement plug at surface.
- Erect marker.

*24 hr. notice*

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED <u>R. R. Suckle</u>	TITLE <u>Production Engineer</u>	DATE <u>2-24-72</u>
APPROVED BY <u>R. R. Suckle</u>	Orig. Signed by <u>Joe D. Ramey</u>	DATE <u>FEB 28 1972</u>
CONDITIONS OF APPROVAL, IF ANY:		