ACCURATION AND A STATE OF THE S	Firm. C-103
DISTRIBUTION	Supersedes Old
SANTA FE NEW MEXICO OIL CONSERVATION COMMISSION	C-102 and C-103 Effective 1-1-65
FILE	
U.S.G.S.	5a. Indicate Type of Lease
LAND OFFICE	State Fee X
OPERATOR	
OPERATOR	5. State Oil & Gas Lease No.
	***************************************
SUNDRY NOTICES AND REPORTS ON WELLS  (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.  USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)	
OIL V GAS	7. Unit Agreement Name
WELL A WELL OTHER-	South Pearl Queen W
2. Name of Operator	8. Farm or Lease Name
Tamarack Petroleum Co., Inc.	
3, Address of Operator	9. Well No.
1485 One First City Center	2
4. Location of Well	10. Field and Pool, or Wildcat
UNIT LETTER C 670.5 FEET FROM THE NORTH LINE AND 1980 FEET FROM	Pearl Queen
FEET FROM THE LINE AND FEET FROM	mmmmmmm
THE West LINE, SECTION 3 TOWNSHIP 20-S RANGE 35-E NMPM.	
THE LINE, SECTION TOWNSHIP ZO D RANGE NMPM.	
15. Elevation (Show whether DF, RT, GR, etc.)	12. County
3683.5 GR	Les: ///////
Check Appropriate Box To Indicate Nature of Notice, Report or Oth	ier Data
MOTIOE OF WITHOUT OF	REPORT OF:
PERFORM REMEDIAL WORK PLUG AND ABANDON X REMEDIAL WORK	ALTERING CASING
TEMPORARILY ABANDON COMMENCE DRILLING OPNS.	PLUG AND ABANDONMENT
PULL OR ALTER CASING CHANGE PLANS CASING TEST AND CEMENT JQB	ALD AND ABANDONMENT
OTHER	۲
OTHER	
17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including	estimated date of starting any proposed
work) SEE RULE 1103.	
1 Morro in and reign and r	
1. Move in and rig up plugging unit on/or about May 1, 1986	
2. Attempt to pull tubing. (Pump stuck at 4988 and top of 3/4" rods a	t 3750').
If cannot pull tubing, pump water down backside, try again, then backside	ck off near or below
top of rods at 3750'. Set cement retainer near top of fish and pum	p 100 sxs leaving
20 feet (2 sxs) on top of retainer.	
3. If pulled out of hole with tubing, rods and pump. Set CIBP at + 4	700 (perfs 4755-4955).
Pump 5 sacks cement on plug.	
4. Fill hole with 9.5# mud	
5. Pull casing for stretch if free to below 3315 (B/salt) shoot and p	ull. Place plugs
as below and pull casing as possible.	
6. Pump cement plug from 3300 to 3100.	
7. Pump cement plug from 1800 to 1700 (T/anhydrite 1810')	
8. Pump cement plug from 157 to 57 (B/8 5/8 surface casing 107')	
9. Set 10 sacks cement surface Plug and marker	
10. Clean location	
andre de la companya de la companya La companya de la co	
18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.	
a langet	
SIGNED (Mucho Color) TITLE Engineering Manager	DATE 3/13/86
	2/ TO/ 00
ORIGINAL SIGNED BY JERRY SEXTON	\$8.pm . m. 40.p.c
APPROVED BY DISTRICT I SUPERVISOR	MAR 1 7 1986
APPROVED BY TITLE	DATE TO THE TOTAL OF THE TOTAL