

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEYSUBMIT IN TRIPlicate*
(Other instructions on re-
verse side)Form approved.
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

LC 065649

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/> Water Injection Well		7. UNIT AGREEMENT NAME South Pearl Queen	
2. NAME OF OPERATOR Tamarack Petroleum Company, Inc.		8. FARM OR LEASE NAME South Pearl Queen Unit	
3. ADDRESS OF OPERATOR P. O. Box 2046, Midland, TX 79702		9. WELL NO. 27	
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface 660' FEL & 330' FNL, Section 8, T-20-S, R-35-E		10. FIELD AND POOL, OR WILDCAT Pearl Queen	
14. PERMIT NO.		11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA 8-20S-35E	
15. ELEVATIONS (Show whether DF, RT, GR, etc.) 3687.5 DF		12. COUNTY OR PARISH Lea	
		13. STATE New Mexico	

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

☐
☐
☐
☐

PULL OR ALTER CASING

☐
☐
☐
☐

FRACTURE TREAT

MULTIPLE COMPLETE

SHOOT OR ACIDIZE

ABANDON*

REPAIR WELL

CHANGE PLANS

(Other)

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

☐
☐
☐

REPAIRING WELL

FRACTURE TREATMENT

ALTERING CASING

SHOOTING OR ACIDIZING

ABANDONMENT*

(Other)

☐
☐
☒(NOTE: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

PLUG AND ABANDON NO LONGER NECESSARY WATER INJECTION WELL

1. Move in and rig up plugging unit August 3, 1985.
2. Unset Baker AD-1 tension Packer and pull out of hole on August 5, 1985.
3. Set CIBP at 4950' (perfs 5054'-63'), Dump 5 sacks cement on plug.
4. Run in hole with 2 3/8" tubing and circulate with 9.5# mud.
5. Pulled 75,000# on 4 1/2" casing parted at 187' below ground. Run in hole with tubing to 3686' and pump 20 sacks cement. Pump 20 sacks cement @ 2062' (200' fill each).
6. Pump 40 sacks cement @ 260'
7. Tag plug at 60'
8. Set 10 sacks cement surface plug and marker Aug. 7, 1985.
9. Clean location.

18. I hereby certify that the foregoing is true and correct

SIGNED

Randy A. McElroy

TITLE

Engineering Manager

DATE 8/27/85

(This space for Federal or State office use)

APPROVED BY

TITLE

DATE

10-2-86

CONDITIONS OF APPROVAL, IF ANY:

*See Instructions on Reverse Side