Submit 3 Copies to Appropriate District Office

State of New Mexico Energy, Minerals and Natural Resources Department

Form C-103 Revised 1-1-89

Revised 1-1-4

DISTRICT I P.O. Box 1980, Hobbs, NM 88240	OIL CONSERVATI 310 Old Santa Fe Tr	ail, Room 206	WELL API NO. 30-025-03998
DISTRICT II P.O. Drawer DD, Artesia, NM \$8210	Santa Fe, New Me	xi∞ 87503	5. Indicate Type of Lease STATE X FEE
DISTRICT III 1000 Rio Brazos Rd., Aziec, NM 874	110		6. State Oil & Gas Losse No. B 7355-1
(DO NOT USE THIS FORM FOR DIFFERENT RE	OTICES AND REPORTS ON WE PROPOSALS TO DRILL OR TO DEEPE SERVOIR. USE "APPLICATION FOR P IM C-101) FOR SUCH PROPOSALS.)	NOR PLUG BACK TO A	7. Lease Name or Unit Agreement Name
1. Type of Well: OIL GAS WELL WELL	X Ones		State KP 13
2. Name of Operator Conoco, Inc.			8. Well No.
3. Address of Operator	ito 100W Midland Town	3 79705	9. Pool name or Wildcat
4. Well Location	ite 100W, Midland, Texas		Eumont Yates 7 Rvrs Qn (Gas)
Unit Letter $F: 1$	98() Feet From The North	Line and1980	Feet From The West Line
Section 13		tange 36-E j	NMPM Lea County
	10. Elevation (Show whether	r DF, RKB, RT, GR, etc.)	
Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data			
	NTENTION TO:	•	SEQUENT REPORT OF:
PERFORM REMEDIAL WORK	PLUG AND ABANDON	REMEDIAL WORK	ALTERING CASING
TEMPORARILY ABANDON	CHANGE PLANS	COMMENCE DRILLING	OPNS. PLUG AND ABANDONMENT X
		•	
PULL OR ALTER CASING		CASING TEST AND CEN	MENT JOE!
OTHER:	· □	CASING TEST AND CEN	AENTJOB L
OTHER:	permisons (Clearly state all pertinent details,	OTHER:	ding estimated date of starting any proposed
12. Describe Proposed or Completed Opwork) SEE RULE 1103.	permisons (Clearly state all pertinent details, IIRU, POOH w/tbg.	OTHER:	
12. Describe Proposed or Completed Opwork) SEE RULE 1103. 10-18-95: M.		OTHER:	
12. Describe Proposed or Completed On work) SEE RULE 1103. 10-18-95: M. 10-19-95: C	IIRU, POOH w/tbg.	OTHER:and give pertinent dates, inclu	
12. Describe Proposed or Completed Of work) SEE RULE 1103. 10-18-95: M 10-19-95: C 10-20-95: R 10-23-95: R	MIRU, POOH w/tbg. Clean hole to 3684'. RIH and set CIBP @ 3670' RIH w/open ended tubing	other: and give periment dates, include to 3655', displa IBP. POOH to 11 urface from insi	ced hole w/salt gel mud. 19'. Pumped 350 sx C1 C de and outside 5-1/2"
12. Describe Proposed or Completed On work) SEE RULE 1103. 10-18-95: M. 10-19-95: C. 10-20-95: R. 10-23-95: R. S. C.	AIRU, POOH w/tbg. Clean hole to 3684'. RIH and set CIBP @ 3670' RIH w/open ended tubing Spotted 100' cement on Clement. Circulated to seasing. POOH, filled w/	other: to 3655', displa IBP. POOH to 11 urface from insi cement to surfac	ced hole w/salt gel mud. 19'. Pumped 350 sx C1 C de and outside 5-1/2"
12. Describe Proposed or Completed On work) SEE RULE 1103. 10-18-95: M. 10-19-95: R. 10-23-95: R. S. C.	AIRU, POOH w/tbg. Clean hole to 3684'. RIH and set CIBP @ 3670' RIH w/open ended tubing Spotted 100' cement on Comment. Circulated to seasing. POOH, filled w/	other: to 3655', displa IBP. POOH to 11 urface from insi cement to surfac	ced hole w/salt gel mud. 19'. Pumped 350 sx Cl C de and outside 5-1/2" e. Cut off wellhead,
12. Describe Proposed or Completed On work) SEE RULE 1103. 10-18-95: M. 10-19-95: C. 10-20-95: R. 10-23-95: R. S. C.	AIRU, POOH w/tbg. Clean hole to 3684'. RIH and set CIBP @ 3670' RIH w/open ended tubing Spotted 100' cement on Comment. Circulated to seasing. POOH, filled w/mstalled marker.	other: to 3655', displa IBP. POOH to 11 urface from insi cement to surfac	ced hole w/salt gel mud. 19'. Pumped 350 sx Cl C de and outside 5-1/2" e. Cut off wellhead,
12. Describe Proposed or Completed On work) SEE RULE 1103. 10-18-95: M. 10-19-95: C. 10-20-95: R. 10-23-95: R. S. C.	AIRU, POOH w/tbg. Clean hole to 3684'. RIH and set CIBP @ 3670' RIH w/open ended tubing Spotted 100' cement on Comment. Circulated to seasing. POOH, filled w/constalled marker.	other: . to 3655', displa IBP. POOH to 11 urface from insi cement to surface Regulatory (915)	ced hole w/salt gel mud. 19'. Pumped 350 sx Cl C de and outside 5-1/2" e. Cut off wellhead,
12. Describe Proposed or Completed On work) SEE RULE 1103. 10-18-95: M. 10-19-95: C. 10-20-95: R. 10-23-95: R. S. C.	AIRU, POOH w/tbg. Clean hole to 3684'. RIH and set CIBP @ 3670' RIH w/open ended tubing Spotted 100' cement on Comment. Circulated to seasing. POOH, filled w/mstalled marker.	other: to 3655', displa IBP. POOH to 11 urface from insi cement to surfac	ced hole w/salt gel mud. 19'. Pumped 350 sx Cl C de and outside 5-1/2" e. Cut off wellhead,

10

de