

EMSUB # 917
API # 30-025-04293
1980' FSL & 660' FWL
S23, T20S ,R36E, & Unit L
Eunice Monument South Unit B
Lea County, New Mexico

February 13, 2001

PROCEDURE TO TEMPORARILY ABANDON WELL:

Notify OCD/BLM 24 hrs prior to work commencing.

1. Verify anchors have been set & tested.
2. MIRU PU. ND WH. NU BOP.
3. TOH w/tbg. TIH w/4-3/4" bit, csg scraper, & WS. Make bit trip to 3720'. POH.
4. Set CIBP @ 3700'. Dump 3 sx Class 'C' cmt on CIBP.
5. TIH w/WS to TOC. Circulate csg w/corrosion inhibited pkr fluid. TOH.
6. Perform MIT (500 PSI for 30 min.).
7. ND BOP. NU WH. RD PU.
8. Clean and clear location.

T. Love 687-7645