Submit 3 Copies to Appropriate District Office

1. Type of Well: ΚX WELL

2. Name of Operator

3. Address of Operator

PERFORM REMEDIAL WORK

'PORARILY ABANDON

FULL OR ALTER CASING

OTHER:

4. Well Location

State of New Mexico Energy, Minerals and Natural Resources Department

P.O. Box 1980, Hobbs, NM 88240

ERICITI J. Drawer DD, Artesia, NM 88210

DISTRICTIII 1000 Rio Brazos Rd., Aztec, NM 87410

Chevron U.S.A. Inc.

P.O. Box 670, Hobbs, NM

OIL CONSERVATION DIVISION

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

C: 660 Feet From The

NOTICE OF INTENTION TO:

. ***	
State of New Mexico Energy, Minerals and Natural Resources Department	Form C-103 Revised 1-1-89
OIL CONSERVATION DIVISION	
P.O. Box 2088	WELL API NO. 30-025-04321
Santa Fe, New Mexico 87504-2088	5. Indicate Type of Lease
	STATE X FEE
M 87410	6. State Oil & Gas Lease No.
RY NOTICES AND REPORTS ON WELLS	
FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A NT RESERVOIR. USE "APPLICATION FOR PERMIT"	7. Lease Name or Unit Agreement Name
(FORM C-101) FOR SUCH PROPOSALS.)	
GAS —	
GAS WELL OTHER	Eunice Monument South Unit
. Inc.	8. Well No.
i. III	9. Pool name or Wildcat
Hobbs, NM 88240	Eunice Monument GB/SA
Township 20 S Range 36 F. 10. Elevation (Show whether DF, RKB, RT, GR, etc.)	Feet From The West Line NMPM Lea County
10. Elevation (Show whether Dr., RKB, RI, GR, etc.)	
Check Appropriate Box to Indicate Nature of Notice, R	eport, or Other Data
	SEQUENT REPORT OF:
PLUG AND ABANDON REMEDIAL WORK	ALTERING CASING
CHANGE PLANS COMMENCE DRILLING	OPNS. PLUG AND ABANDONMENT
CASING TEST AND CE	MENT JOB C
OTHER: perf. acc	iz 🗓
eted Operations (Clearly state all pertinent details, and give pertinent dates, included	ding estimated date of starting any proposed
d: 2-14-89 thru 2-17-89 TD: 4059	
tion equipment. Perf w/ 2 3/4" csg guns, 2 3 t 3824-30', 3796-3800, 3750-52, 3724-28. GIF pkr at 3773'. Acdz perfs in zone #2 w/600 ga 1 10# gel., flush to bottom perf w/ CKF. Set	H and set RBP at 3838.

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, included the completed operations (Clearly state all pertinent details, and give pertinent dates, included the completed operations (Clearly state all pertinent details, and give pertinent dates, included the completed operations). work) SEE RULE 1103.

Work performed: 2-14-89 thru 2-17-89

POOH w/production equipment. Perf w/ 2 3/4" csg guns, 2. zones 1 & 2 at 3824-30', 3796-3800, 3750-52, 3724-28. GII POOH and set pkr at 3773'. Acdz perfs in zone #2 w/600 ga GRS in 400 gal 10# gel., flush to bottom perf w/ CKF. Set 3686'. Acdz perfs f/3724'-3830 w/400 gallons 15% NEFE HCL. Flush to bottom perf w/ CKF. Swab. Release pkr and tag salt at 3830', cleanout 15' salt to 3845'. Retrieve RBP, run 2 3/8" prod. tbg, to 3940'. ND BOP, NUWH. Run production equipment. Load and test pmp equip to 500psi, ok. Replumb well to flowline and pick up location. RDMOPU.

LEPHONE NO.
те 2-22-89

- TITLE -

DISTRICT I SUPERVISOR

CONDITIONS OF APPROVAL, IF ANY: