

EMSU # 119
API # 30-025-04327
1980' FSL & 1980' FEL
S25, T20S, R36E, & Unit J
Eunice Monument South Unit
Lea County, New Mexico

February 19, 2001

PROCEDURE TO TEMPORARILY ABANDON WELL:

Notify OCD/BLM 24 hrs prior to work commencing.

1. Verify anchors have been set & tested.
2. MIRU PU. ND WH. NU BOP.
3. TOH w/ tbg. TIH w/4-3/4" bit, csg scraper, & WS. Make bit trip to 3412'. POH.
4. TIH w/ WS to 3410'. Spot 100' balanced Class 'C' cmt plug from 3410' to 3310.
TOH. WOC.
5. Perform MIT (500 PSI for 30 min.).
6. ND BOP. NU WH. RD PU.
7. Clean and clear location.

T. Love 687-7645