

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO.	30-025-05611
5. Indicate Type of Lease	STATE ☒ FEE ☐
6. State Oil & Gas Lease No.	B-2656
7. Lease Name or Unit Agreement Name	STATE A-17
8. Well No.	2
9. Pool name or Wildcat	Eunice Monument GB/SA RUBEN YATES 7 RYRS QUEEN
10. Elevation (Show whether DF, RKB, RT, GR, etc.)	DF 3710

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: OIL WELL ☒ GAS WELL ☐ OTHER ☐	2. Name of Operator CONOCO INC.
3. Address of Operator 10 Desta Drive STE 100W, Midland, TX 79705	4. Well Location Unit Letter <u>N</u> : <u>660</u> Feet From The <u>SOUTH</u> Line and <u>1980</u> Feet From The <u>WEST</u> Line Section <u>17</u> Township <u>19S</u> Range <u>37E</u> NMPM LEA County <u>LEA</u>
10. Elevation (Show whether DF, RKB, RT, GR, etc.) DF 3710	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☐	REMEDIAL WORK ☐	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPNS. ☐	PLUG AND ABANDONMENT ☒
PULL OR ALTER CASING ☐	OTHER: ☐	CASING TEST AND CEMENT JOB ☐	OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

5-7-92 MIRU. DO TO 2350', CIRC HOLE W/ 9.5# SALT GEL MUD. SPOT 80 SX CEMENT FROM 2350 TO 1550. RIH & TAG PLUG AT 2058'. SPOT 50 SX FROM 2059' UP. RIH TAG PLUG @ 2026'. SPOT 50 SX FROM 2026' UP. TAG PLUG @ 1931'. SPOT 40 SX FROM 1931'. TAG PLUG @ 1868'. SPOT 40 SX FROM 1868'. TAG PLUG AT 1755'. PERF 5 1/2" AT 1470'. SPOT 30 SX FROM 1480'. DISPLACED 15 SX OUT SQUEEZE HOLES. TAGGED @ 1745'. PU TO 1480' SPOT 50 SX. RIH TAG AT 1740'. PU TO 1003' PUMP 200 SX CIRC CMT TO SURFACE UP 5 1/2" & 7 5/8" ANNULUS. CIRC 5 1/2" W. 9# MUD. PERF 5 1/2" @ 75'. GIH TO 360' PUMP 60 SX TO SURFACE IN 5 1/2" & 5 1/2" X 7 5/8" ANNULUS. CUTOFF WELLHEAD. FILL IN CELLAR & CLEAN LOCATION. INSTALL P&A MARKER. RDMO. WELL P&A 5-22-92

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Bill R. Keathly TITLE SR REGULATORY SPEC. DATE 6-3-92
TYPE OR PRINT NAME BILL R. KEATHLY TELEPHONE NO. 915-686-5424

(This space for State Use)

APPROVED BY Charles Perrin TITLE OIL & GAS INSPECTOR DATE SEP 14 '92

CONDITIONS OF APPROVAL, IF ANY:

RECEIVED
JUN 04 1992
OCD HOBBS OFFICE