DUPLICA

NEW MEXICO OIL CONSERVATION COMMISSION

RECEIVED

MISCELLANEOUS REPORTS ON WELLIS

MAR 5 1952

Submit this report in triplicate to the Oil Conservation Commission District Office within text days after its line is completed. It should be signed and filed as a report on beginning drilling operations, results of shooting well, results of test of casing shut off, result of plugging of well, and other important operations, even though the work was witnessed by an agent of the Commission. See additional instructions in the Rules and Regulations of the Commission.

	Indicate nature of	report by checking below	v.	
REPORT ON BEGINNING DRIL OPERATIONS	LING	REPORT ON R	EPAIRING WELL	X
REPORT ON RESULT OF SHOOTING OR CHEMICAL TREATMENT OF WELL		REPORT ON P	ULLING OR OTHERWISE CASING	
REPORT ON RESULT OF TEST OF CASING SHUT-OFF		REPORT ON D	EEPENING WELL	
REPORT ON RESULT OF PLUG	GING OF WELL			
	Ferch 4, 1952	Date	Hobbs, New Merdico	
		Date	Place	***************************************
Following is a report on the work of Continental Oil Company	done and the results obtaing	ined under the heading not	ed above at the	
Continental Oil Company or O	perator 17	Lease 198		in the
Lonument	of Sec.	, T	, R	N. M. P. M.,
	Pool			County.
and approval of the proposed plan v DETAILI The subject vall this condition a bridge	was (was not) obtained. (ED ACCOUNT OF WOF Was producing oi o plug was set at	Cross out incorrect words. RK DONE AND RESULT 1 from the Braden 3315: A retrice	s obtained head. In an attempt vable retainer was r	to repo
and approval of the proposed plan v DETAILI The Subject (2211	was (was not) obtained. (ED ACCOUNT OF WOR Was producing of plug was set at 5 1/2" casing. Boure and running t 1125 and while and a ueozod with Costed o'my. Dri 12-17-52.	Cross out incorrect words. RK DONE AND RESULT I from the Braden 3315*. A retrice S usezed hele with retrievable rute checking same, for 200 sacks. Dril) s obtained head. In an attempt vable retainer was r h 50 sacks cement ar iner, found leak at ound second leak at led to 30154 and tes	to reparun and after 12251.
The subject wall this condition a bridge found hole at 1225* in testing with 1500% pres Set model K retainer at but retainer at 1023* a with 1800% pressure. To orkover started orkover complete	was (was not) obtained. (ED ACCOUNT OF WOR Was producing of plug was set at 5 1/2" casing. Boure and running t 1125 and while and a ueozod with Costed o'my. Dri 12-17-52.	Cross out incorrect words. RK DONE AND RESULT I from the Braden 3315*. A retrice S usezed hele with retrievable rute checking same, for 200 sacks. Dril) s obtained head. In an attempt vable retainer was r h 50 sacks cement ar iner, found leak at ound second leak at led to 30154 and tes	to reparun and after 12251.
The subject wall this condition a bridge found hole at 1225* in testing with 1500% pres but retainer at 1023* a with 1800% pressure. The	was (was not) obtained. (ED ACCOUNT OF WOR Was producing of plug was set at 5 1/2" casing. Boure and running t 1125 and while and a ueozod with Costed o'my. Dri 12-17-52.	Cross out incorrect words. RK DONE AND RESULT I from the Braden 3315*. A retrice S usezed hele with retrievable rute checking same, for 200 sacks. Dril) s obtained head. In an attempt vable retainer was r h 50 sacks cement ar iner, found leak at ound second leak at led to 30154 and tes	to reparun and after 1225. 1100. ted pape
The subject wall this condition a bridge found hole at 1225* in testing with 1500% pres Set model K retainer at but retainer at 1023* a with 1800% pressure. To orkover started orkover complete	was (was not) obtained. (ED ACCOUNT OF WOF WAS producing of plug was set at 5 1/2" casing. Boure and running t 1125" and while and a ueozod with Costed o'my. Dri 12-17-52. ed: 2-26-52.	Cross out incorrect words. RK DONE AND RESULT I from the Braden 3315: A retrice S usezed hole with retrievable retrice checking same, for 200 sacks. Brill lled retainer to	es obtained head. In an attempt head. In an attempt vable retainer was respected by the second leak at ound second leak at led to 3015° and too total depth 4003°.	to report and after 1225. 1100. ted pipe
The subject wall this condition a bridge found hole at 1225* in testing with 1500% pres Set model K retainer at but retainer at 1023* a with 1800% pressure. To corkever started corkever complete	was (was not) obtained. (ED ACCOUNT OF WOF WAS producing of plug was set at 5 1/2" casing. Boure and running t 1125" and while and a ueozod with Costed o'my. Dri 12-17-52. ed: 2-26-52.	Cross out incorrect words. RK DONE AND RESULT I from the Braden 3315*. A retrior S usezed hele with retrievable retri- checking same, for 200 sacks. Dril Bled retrievable retrievable Company I hereby swear or a is true and correct. Name	s obtained head. In an attempt wable retainer was refiner was refiner, found leak at ound second leak at led to 3015° and testotal depth 4003°.	to report and after 1225. 1100. ted pipe
The subject wall this condition a bridge found hole at 1225* in testing with 1500% pres Set model K retainer at but retainer at 1023* a with 1800% pressure. To corkever started corkever complete	was (was not) obtained. (ED ACCOUNT OF WOF WAS producing of plug was set at 5 1/2" casing. Boure and running t 1125" and while and a ucozod with Cested o'my. Dri 12-17-52. ed: 2-26-52.	Cross out incorrect words. RK DONE AND RESULT I from the broden. 3315*. A retrice S usezed hele with retrievable retrice checking same, for 200 sacks. Dril Bed retrievable retrice Company I hereby swear or a is true and correct. Name	be obtained head. In an attempt head. In an attempt vable retainer was a h 50 sacks cement as iner, found leak at ound second leak at led to 3015 and too total depth 4003.	to reparun and after 1225 . 1100 . ted pipe
The subject wall this condition a bridge found hole at 1225* in testing with 1500% pres Set model K retainer at but retainer at 1023* a with 1800% pressure. To corkever started corkever complete	was (was not) obtained. (ED ACCOUNT OF WOF WAS producing of plug was set at 5 1/2" casing. Bourc and running t 1125" and while and a usecod with Casted o'my. Dri 1-17-52. ed: 2-26-52.	Cross out incorrect words. RK DONE AND RESULT. I from the broden. 3315: A retrice. S woozed hole with retrievable retrieva	be obtained head. In an attempt head. In an attempt vable retainer was a h 50 sacks cement as iner, found leak at ound second leak at led to 3015 and too total depth 4003. Title offirm that the information golden.	to reparent of the total of the