

1. NAME
 2. ADDRESS
 3. CITY
 4. STATE
 5. ZIP
 6. PHONE
 7. FAX
 8. E-MAIL
 9. LAND OFFICE
 10. OPERATOR

OIL CONSERVATION DIVISION
 P. O. BOX 2088
 SANTA FE, NEW MEXICO 87501

Form O-103
 Revised 10-1-73

1. Indicate Type of Lease
 State ☐ Fee ☒
 2. State Oil & Gas Lease No.

SUNDARY NOTICES AND REPORTS ON WELLS
 (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
 USE APPLICATION FOR PERMIT - (FORM O-101) FOR SUCH PROPOSALS.)

1. Unit Agreement Name
 East Eumont Unit
 2. Firm or Lease Name
 -
 3. Well No.
 81
 4. Field and Pool, or Wildcat
 Eumont Y-7R-Q
 5. Elevation (Show whether DF, RT, CR, etc.)
 3613' DF
 6. County
 LEA

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
 NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:
 1. REMEDIAL WORK ☐ 2. PLUG AND ABANDON ☐ 3. REMEDIAL WORK ☐ 4. ALTERING CASING ☐
 5. CASING TEST AND CEMENT JOB ☐ 6. COMMENCE DRILLING OPNS. ☐ 7. PLUG AND ABANDONMENT ☒
 8. OTHER ☐ 9. CASING TEST AND CEMENT JOB ☐ 10. OTHER ☐

Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed operations) SEE RULE 1103.

1. MIRUPU. TIH w/ workstring. Tagged CIBP @ 3700'. RU Halliburton
2. Displaced hole w/ 100 bbl. 10# salt gel mud (27 sxs.)
3. Spotted 10 sxs. class "H" neat cmt. @ 3600-3700'.
4. Pulled tbq. to 1661'. Spotted 25 sxs. class "H" neat cmt. @ 1420-1661'.
5. Pulled tbq. to 491'. Spotted 10 sxs. class "H" neat cmt. @ 387-487'.
6. Pulled tbq. to 96'. Spotted 10 sxs. class "H" neat cmt. @ 0-96'.
7. RDPU. Cut off wellhead. Installed marker. Cleaned location and removed dead men.
8. Abandon well. P and A.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

W. B. Loh Dist. Opr. Mgr. DATE 12-04-85

OIL & GAS INSPECTOR JAN 23 1986