

NO. OF COPIES RECEIVED		
DISTRIBUTION		
SANTA FE		
FILE		
U.S.G.S.		
LAND OFFICE		
OPERATOR		

HOBBS OFFICE O.C.C.  
NEW MEXICO OIL CONSERVATION COMMISSION  
JAN 7 3 59 PM '66

Form C-103  
Supersedes Old  
C-102 and C-103  
Effective 1-1-65

### SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>		5a. Indicate Type of Lease State <input checked="" type="checkbox"/> Fee <input type="checkbox"/>
2. Name of Operator <b>Gulf Oil Corporation</b>		5. State Oil & Gas Lease No. <b>3998</b>
3. Address of Operator <b>Box 670, Hobbs, New Mexico</b>		7. Unit Agreement Name
4. Location of Well UNIT LETTER <b>E</b> <b>1980</b> FEET FROM THE <b>North</b> LINE AND <b>660</b> FEET FROM THE <b>West</b> LINE, SECTION <b>29</b> TOWNSHIP <b>19-S</b> RANGE <b>37-E</b> NMPM.		8. Farm or Lease Name <b>Fred Lathy</b>
15. Elevation (Show whether DF, RT, GR, etc.) <b>3622' GL</b>		9. Well No. <b>1</b>
		10. Field and Pool, or Wildcat <b>Monument</b>
		12. County <b>Lea</b>

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK ☐  
TEMPORARILY ABANDON ☐  
PULL OR ALTER CASING ☐  
OTHER ☐

PLUG AND ABANDON ☐  
CHANGE PLANS ☐  
OTHER ☐

REMEDIAL WORK ☐  
COMMENCE DRILLING OPNS. ☐  
CASING TEST AND CEMENT JOB ☐  
OTHER ☐  
ALTERING CASING ☐  
PLUG AND ABANDONMENT ☐

**Plugged back and shut off water (DID NOT ACIDIZE)**

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

**3896' PB. Checked PB at 3929' with wire line. Checked PB with depthometer at 3932'. (Apparently hydromite plug installed in February, 1963, had washed out from PB at 3903'). Dumped 25 gallons of hydromite, pressured with 400# water pressure. Checked PB at 3904'. Dumped 8 gallons of hydromite. Pumped 20 barrels of water down casing. Checked fill up at 3896'. Ran 2-3/8" tubing and Baker Model "A" packer. Set tubing at 3860', seating nipple at 3844'. Left packer unseated. Ran rods and pump and returned well to production.**

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

ORIGINAL SIGNED BY

**L. A. TURNER**

SIGNED **L. A. TURNER** TITLE **Area Petroleum Engineer**

DATE **January 7, 1966**

APPROVED BY  TITLE \_\_\_\_\_ DATE \_\_\_\_\_  
CONDITIONS OF APPROVAL, IF ANY: