

TEMPORARY ABANDONMENT PROCEDURE

BRITT "B" NO. 2 WELL
Eunice - Monument Field
Lea County, New Mexico

1. MIRUSU.
2. Kill well as required.
3. ND tree. NU BOP's.
4. Release packer and POH with tubing. If unable to release packer, attempt to activate on-off tool and POH. If still unable to POH, freepoint tubing and cut just above packer if free.
5. RU wireline unit. RIH with gauge ring and junk basket to PBTD (CIBP at 3490'). POH. RIH with dump bailer and dump 35' (5 sx) of cement on top of CIBP at 3490'.
6. RIH with CIBP on wireline. ✓ Set same at 3330'. RIH with dump bailer and dump 35' (5 sx) of cement on top of plug. ✓
7. RIH with CIBP on wireline. Set same at 3110'. Dump 35' (5 sx) of cement on top of CIBP. RD wireline unit.
8. Pressure test casing to 500 psig surface pressure. ✓
9. TIH with tubing to PBTD. Circulate hole completely with *inhibited packer fluid.
10. POH with tubing and make sure hole is completely loaded with *inhibited packer fluid.
11. Remove BOP and install wellhead with tapped bull plug and needle valve.
12. RDMOSU.

* FLUID SPECIFICATIONS

20 Gal of Unichem TH-606 per 100 Bbl of Fresh Water

GRH/ejw
a:tabrt-2
07/06/89