

PLUGGING BACK PROCEEDURE: Ran SLM and found top of cavings at 3886'. Ran 4-1/4" OD sand pump and cleaned out from 3886' to 3889'. Dumped 32 gallons Hydromite from 3889' to 3861' by HOWCO. Well would not flow. Ran SLM and found bottom at 3876'. Dumped 8 gallons Hydromite. Ran SLM, found bridge at 3836'. Ran bailer and knocked out three bridges, found bottom at 3871'. Ran sand pump and cleaned out soft hydromite from 3871' to 3877'. Dumped 1 gallon pea gravel from 3877' to 3876'. Dumped 24 gallons Hydromite from 3876' to 3874'. Dumped 2 gallons pea gravel from 3874' to 3872'. Dumped 16 gallons Hydromite - no fill up. Dumped 2 gallons pea gravel 3872' to 3870'. Dumped 8 gallons Hydromite from 3870' to 3869'. Dumped 8 gallons Hydromite from 3869' to 3858'. Job complete May 4, 1952.

Production before plugging back: Well Dead.

Production on test after plugging, acidizing and installing Gas lift, Flowed 65 bbls oil and 29 bbls water in 24 hours using outside gas.