

**G. C. Matthews #7
Section 6, T20S, R37E
Lea County, New Mexico
WBS UWPWB-A0018**

Recommended P&A Procedure

1. MIRU PU. Conduct Safety Meeting. Contact OCD. ND WH. NU BOP.
2. PU Tbg and TIH.
3. Place a balanced cement plug from 5250' - 5085' (Paddock perms). Tag plug.
4. Place a 100' balanced cement plug 2572'-2472' (8 5/8" casing shoe). Tag plug.
5. Place a 100' balanced cement plug from 341' - 241' (12 3/4" casing shoe). Tag plug.
6. Place a 100' balanced cement plug from 100' - surface. (surface plug)
7. Cut off well head and set P&A marker.
8. RD PU. Cut off anchors. Change well status to P&A.
9. Restore surface location.

→ SALT PLUG 1090' - 990'

Lloyd Trautman
October 10, 2000