

10. Cement liner top w/450 sx class H cement containing 2% Cacl. WOC.DOC. Tested to 1500# for 30 minutes, 6:00-6:30 PM, 10-12-81. Tested ok.
11. Perforate 4" liner w/2-JSPF @ 21', 22', 23', 26', 34', 40', 44', 48', 60', 66', 79', 85', 90', 96', 7503', 20', 28', 49', 54', 65', 84', 92, 7611', 16', 30', 38', 44', 48', & 7653'.
12. Set pkr @ 7120'. Acidize 4" liner perfs. 7420'-7653' w/7250 gals 20% NEFE acid & 100 ball sealers. Flush w/40 Bbls fresh water.
13. Acidize perfs. 7420'-7653' w/8000 gals. 20% NEFE Acid in 8 stages using 200#-400# rock salt in gelled brine between stages. Flush w/33 Bbls. Treated water.
14. Install pumping equipment. Test & place Monument Abo on Production .