

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

SEP 15 1966

5a. Indicate Type of Lease
State <input type="checkbox"/> Fee <input checked="" type="checkbox"/>

5. State Oil & Gas Lease No.
Fee

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	7. Unit Agreement Name NONE
2. Name of Operator TEXACO Inc.	8. Farm or Lease Name J. R. Phillips
3. Address of Operator P. O. Box 728 - Hobbs, New Mexico	9. Well No. 5
4. Location of Well UNIT LETTER <u>D</u> <u>660</u> FEET FROM THE <u>North</u> LINE AND <u>660</u> FEET FROM THE <u>West</u> LINE, SECTION <u>6</u> TOWNSHIP <u>20-S</u> RANGE <u>37-E</u> N.M.P.M.	10. Field and Pool, or Wildcat Monument-Blinebry
15. Elevation (Show whether DF, RT, GR, etc.) 3583' (D. F.)	12. County Lea

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK <input type="checkbox"/>	REMEDIAL WORK <input checked="" type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	CASING TEST AND CEMENT JOBS <input type="checkbox"/>
OTHER <input type="checkbox"/>	OTHER <input type="checkbox"/>
PLUG AND ABANDON <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
CHANGE PLANS <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

We have abandoned the Monument-Blinebry Pool, and attempt re-completion in the Paddock Pool:

1. Pull rods & tubing, set Cast Iron bridge plug at 51450', cap with cement.
2. Perforate 5 1/2" Casing with two jet shots at 5130', 5139', 5144', 5149', 5155', 5162', 5167', 5177', 5183', 5187', 5199', 5204', 5210', 5215', and 5220'.
3. Set packer at 5250'. Acidize with 100 gals 15% NE acid, Re-acidize with 1000 gallons 15% NE acid in four 250 gallon stages with four ball sealers between each stage. Swab well, no new oil, Shut Well In.
4. Well SHUT IN, effective 7:00 A. M. September 1, 1966

MUST BE NOTIFIED
THE COMMISSION ON FORM C-103
EVERY 6 MONTHS ON STATUS AND YOUR
AS TO THE WELL FOR THIS WELL

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.		
SIGNED <u>Dan Gillett</u>	TITLE <u>Assistant District Superintendent</u>	DATE <u>September 15, 1966</u>
APPROVED BY _____	TITLE _____	DATE _____
CONDITIONS OF APPROVAL, IF ANY:		