

12. PU tubing to 50' mix and spot 15 sx plug back to surface. POOH.
13. Cut off casing 3' below recontoured ground level. Weld steel plate on casing. Install 4" x 10' (4' above ground) abandoned well marker with well name, number and location inscribed in same.
14. Clean up location backfilling cellar and any pits.

NOTE: Cement plugs are calculated on 14.8 ppg and 1.32 cu.ft./sk.

036/AA