

Submit 3 copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I

P.O. Box 1980, Hobbs, NM 88240

DISTRICT II

P.O. Box Drawer DD, Artesia, NM 88210

DISTRICT III

1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088

Santa Fe, New Mexico 87504-2088

WELL API NO.	30-025-06049
5. Indicate Type of Lease	STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil / Gas Lease No.	TG-314694
7. Lease Name or Unit Agreement Name	L VAN ETEN
8. Well No.	9
9. Pool Name or Wildcat	MONUMENT PADDOCK
10. Elevation (Show whether DF, RKB, RT, GR, etc.)	3550 DF

SUNDRY NOTICES AND REPORTS ON WELL
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: OIL WELL ☒ GAS WELL ☐ OTHER ☐

2. Name of Operator
TEXACO EXPLORATION & PRODUCTION INC.

3. Address of Operator
205 E. Bender, HOBBS, NM 88240

4. Well Location
Unit Letter L : 1650 Feet From The SOUTH Line and 990 Feet From The WEST Line
Section 9 Township 20-S Range 37-E NMPM LEA COUNTY

10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3550 DF

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☒ ALTERING CASING ☐
COMMENCE DRILLING OPERATION ☐ PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☐
OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

6-03-98: MIRU. TOH W/RDS & PMP.

6-04-98: NDWH, NUBOP, REL TAC. TOH W/2 3/8" TBG, TAC, SN, & PERF SUB. TIH W/BIT, CSG SCRAPER & 2 3/8" TBG TO 5211'. TIH W/CIBP, PKR, SN, & TBG. SET CIBP @ 5190'. PULL PKR TO 5129'.

6-05-98: TIH W/2 3/8" TBG. PSA 5180'. TEST CIBP TO 550 PSI. PULL PKR TO 5129'. LOAD & PSI CSG TO 5000 PSI-OK. SWAB 1ST FL @ 1600' FR SURF. RECVD 121 BBLS. END FL @ 3800'.

6-08-98: REL PKR & TOH W/80 JTS 2 3/8" TBG.

6-09-98: TIH W/SN, TBG, & TAC. TEST TBG TO 5000 PSI. NDBOP. SET TAC. NUWH. 2 3/8" SN @ 5184'. TAC @ 5092'. TIH W/STRAINER NIPPLE, PUMP & RDS.

6-10-98: HANG WELL ON. SPACED PUMP. LOAD, TEST & CHECK PUMP ACTION. RIG DOWN.

6-25-98: ON 24 HR OPT. PUMPED 33 BO, 176 BW, & 25 MCF.

FINAL REPORT

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE J. Denise Leake TITLE Engineering Assistant DATE 6/29/98

TYPE OR PRINT NAME J. Denise Leake Telephone No. 397-0405

ORIGINAL SIGNED BY CLAUDE WILLIAMS

(This space for State Use)

DISTRICT I SUPERVISOR

APPROVED BY _____ TITLE _____ DATE JUL 21 1998

CONDITIONS OF APPROVAL, IF ANY: