

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO. 30-025-12483
5. Indicate Type of Lease STATE ☒ FEE ☐
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name STATE B
8. Well No. 1
9. Pool name or Wildcat EUMONT YATES 7 RVRS QN EUMONT YATES 7 RVRS QN

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: OIL WELL ☐ GAS WELL ☒ OTHER	
2. Name of Operator Shell Western E&P Inc.	
3. Address of Operator P.O. Box 576 Houston, TX 77001-0576 (WCK 4587)	
4. Well Location Unit Letter <u>E</u> : <u>1980</u> Feet From The <u>NORTH</u> Line and <u>660</u> Feet From The <u>WEST</u> Line Section <u>36</u> Township <u>19S</u> Range <u>36E</u> NMPM LEA County	
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3599' DF	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK ☐	REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐	ALTERING CASING ☐
PULL OR ALTER CASING ☐	COMMENCE DRILLING OPNS. ☐
OTHER: ☐	PLUG AND ABANDONMENT ☐
	CASING TEST AND CEMENT JOB ☐
	OTHER: SQZD QN - PREP FOR UNITIZATION ☒

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

2-03 TO 3-10-92:

POH W/DUAL PROD EQMT. CO TO 3610'. SET CIBP @ 3600' & CIRC @ 3340'. ATTEMPTD TO SQZ QN PERFS 3400' - 3544' W/150 SX CLS C NEAT CMT. DMPD 1 BBL CMT ON TOP OF CIRC. SET CIRC @ 2905'. ATTEMPTD TO SQZ PERFS 2968' - 3104' W/150 SX CLS C NEAT CMT. TAG TOC @ 2175'. DO CMT TO 2903'. DO CIRC TO 2906', FELL FREE. TAG PBT @ 3338'. PT CSG TO 500#, BLEED OFF 100# IN 30 MIN. SPOT 504 GAL 28% NEFE HCL ACROSS PERFS. ESTAB INJ RT. SET CIRC @ 2903'. PMPD 100 SX CACL CMT. TAG CIRC @ 2903'. DRLD ON CIRC TO 2906'. DO CMT TO 3102', FELL FREE. TAG CIRC @ 3338'. DRLD UP CIRC & CMT TO 3540', FELL FREE. PT CSG TO 500#, DID NOT HOLD. SET PKR @ 3588'. PT CIBP TO 500# FOR 10 MIN, HELD. REL PKR & RESET @ 3347'. PT PERFS BELOW PKR TO 500#, LOST 200# IN 15 MIN. PT PERFS ON BACKSIDE TO 500# FOR 15 MIN, HELD. POH W/PKR. RIH W/OE TBG TO 3565'. SPOT 50 SX MICRO-MATRIX CMT FROM 3565' TO 3320'. PT CSG TO 500# FOR 30 MIN, HELD. TAG TOC @ 3384'. DO CMT TO 3560' & FELL FREE. PT CSG TO 500# FOR 30 MIN, HELD. RETSTD CSG TO 500#, BLEED OFF 80# IN 30 MIN. RIH W/OE TBG. SPOT 50 SX

(CONT'D ON REVERSE SIDE)

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE W. F. N. KELL DORF TITLE TECH. MANAGER - ENVIR. ENG. DATE 3/26/92
TYPE OR PRINT NAME W. F. N. KELL DORF TELEPHONE NO. 713/870-3426

(This space for State Use) ORIGINAL SIGNED BY JERRY GILSON

APPROVED BY _____ TITLE _____ DATE _____

CONDITIONS OF APPROVAL, IF ANY:

Micro-Matrix cmt from 3565' to 3320'. PT csg to 500# for 30 min, held. Tag TCC @ 3272'. DO soft cmt to 3560', fell free. PT csg to 500#, lost 60# in 30 min. Retstd next A.M. PT csg to 500#, held. (Tst witnessed by Eric Haas of Amerada Hess Corp.) Tag CIBP @ 3610'. Drld on CIBP, plug fell free. Pushed plug to 3917'. Inst prod eqmt & RTP.

Well is now ready to be accepted into Amerada's North Monument Grayburg/San Andres Unit.