

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

SUBMIT IN TRIPLICATE*
(Other instructions on re-
verse side)

RECEIVED

Form approved.
Budget Bureau No. 1004-0135
Expires August 31, 1985

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

AUG 6 8 23 AM '90

CAR AREA

1. OIL WELL <input type="checkbox"/> GAS WELL <input checked="" type="checkbox"/> OTHER		7. UNIT AGREEMENT NAME
2. NAME OF OPERATOR Read & Stevens, Inc.		8. FARM OR LEASE NAME Whitten Fed.
3. ADDRESS OF OPERATOR P.O. Box 1518, Roswell, NM 88202		9. WELL NO. 1
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface 1980' FSL & 660' FEL Unit I		10. FIELD AND POOL, OR WILDCAT Lea Penn
14. PERMIT NO.	15. ELEVATIONS (Show whether DF, RT, GR, etc.)	11. SEC., T., E., M., OR BLK. AND SURVEY OR AREA Sec 14-20S-34E
		12. COUNTY OR PARISH 13. STATE Lea NM

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
TEST WATER SHUT-OFF <input type="checkbox"/>	PULL OR ALTER CASING <input type="checkbox"/>	WATER SHUT-OFF <input type="checkbox"/>	REPAIRING WELL <input type="checkbox"/>
FRACTURE TREAT <input type="checkbox"/>	MULTIPLE COMPLETE <input type="checkbox"/>	FRACTURE TREATMENT <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
SHOOT OR ACIDIZE <input type="checkbox"/>	ABANDON* <input type="checkbox"/>	SHOOTING OR ACIDIZING <input type="checkbox"/>	ABANDONMENT* <input checked="" type="checkbox"/>
REPAIR WELL <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	(Other) _____	

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

7-29-90 PU 6 jts tbg, RIH tag CIBP @ 9565', circ hole w/10 ppg mud. Spot cmt plug @ 9565 to 9465, POH. Cut 7" csg @ 5949 and pull and LD csg. RIH w/tbg to 6024 and set 150' plug to 5874', WOC and tag OK. Set 65 sx plug @ 5138-4917, WOC and tag OK. Set 40 sx plug @ 1822-1720'. Set 20 sx surf plug, cut off well head. Install DH marker, clean location.

RECEIVED
 AUG 3 11 57 AM '90
 BUREAU OF LAND MANAGEMENT

18. I hereby certify that the foregoing is true and correct

SIGNED John C. Meyer TITLE Petroleum Engineer DATE 8-1-90

(This space for Federal or State office use)

APPROVED BY John C. Meyer TITLE PETROLEUM ENGINEER DATE 8 7 90

CONDITIONS OF APPROVAL, IF ANY:

Approved as to compliance with the provisions of the Act.
Liability under bond is retained until surface reclamation is completed.

*See Instructions on Reverse Side

PA posted
E