

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

SUBMIT IN TRIPI
(Other instructions
reverse side)

Form approved
Budget Bureau No. 1004-0135
Expires August 31, 1985

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐	7. UNIT AGREEMENT NAME
2. NAME OF OPERATOR Conoco Inc.	8. FARM OR LEASE NAME Britt B
3. ADDRESS OF OPERATOR P.O. Box 460 - Hobbs, New Mexico 88240	9. WELL NO. 23
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface 1980' FWL F' 2080' FSL - Unit Letter K	10. FIELD AND POOL, OR WILDCAT Mona / Monument
14. PERMIT NO. 30-025-20648	11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA 3-20S-37E
15. ELEVATIONS (Show whether DP, RT, GR, etc.)	12. COUNTY OR PARISH Lea
	13. STATE NM

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF	☐	PULL OR ALTER CASING	☐
FRACTURE TREAT	☐	MULTIPLE COMPLETION	☐
SHOOT OR ACIDIZE	☐	ABANDON*	☐
REPAIR WELL	☐	CHANGE PLANS	☐
(Other)	☐		☐

SUBSEQUENT REPORT OF:

WATER SHUT-OFF	☐	REPAIRING WELL	☐
FRACTURE TREATMENT	☐	ALTERING CASING	☐
SHOOTING OR ACIDIZING	☐	ABANDONMENT*	☒
(Other)	☐		☐

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

MIRU. Run CSG scraper to 6425'. Circulate well w/ 160 bbls 9.5 ppq mud (25 sxs salt gel/100 bbl 9 ppq brine). POOH w/ Hg. Run gauge ring & junk basket to 4200'. Set CIBP at 4138'. Spot 25 sxs class "C" neat cement on CIBP from 4138' - 3897'. POOH w/ Hg. Spot 135 sxs class "C" neat cement from 2700' - 1400'. POOH w/ Hg. Perforate at 1325' w/ 4 js pF. POOH. Pump down 5 1/2" CSG & establish circulation out 5 1/2" x 8 7/8" annulus. Pump 300 sxs class "C" neat down 5 1/2" casing & circulate cement out annulus. Install P&A marker. Well P&A on 2/23/88.

18. I hereby certify that the foregoing is true and correct

SIGNED [Signature] TITLE Administrative Supervisor DATE March 29, 1988

The space for Federal or State office use)

APPROVAL OF _____ TITLE _____ DATE _____
CONDITIONS OF APPROVAL, IF ANY:

*See instructions on Reverse Side

SJS